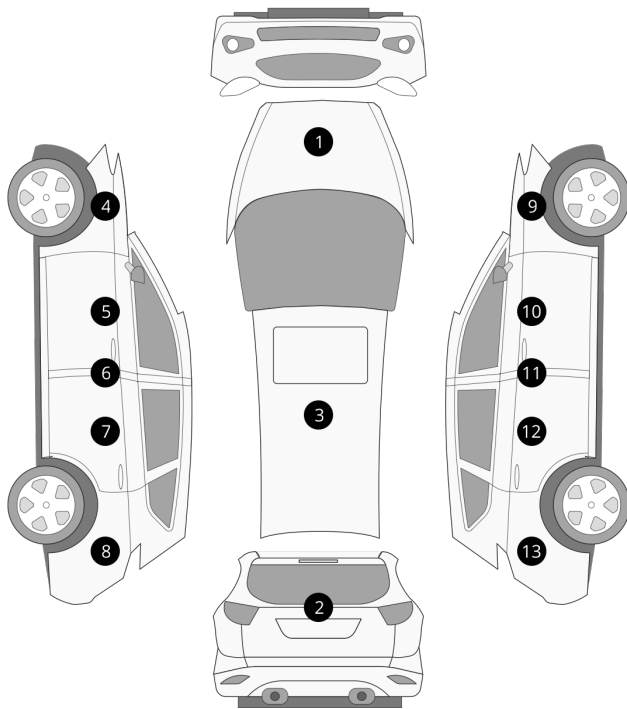


General Information

Date & Time: 04, Aug, 2025 18:07

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	11,723
Registration No.	NIN4880	Chassis No.	PA1B18F35P4209487
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



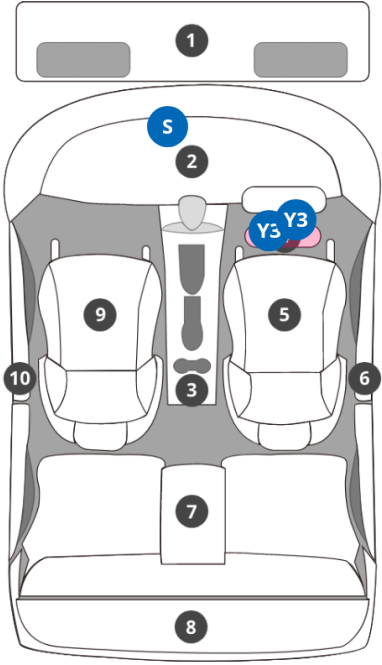
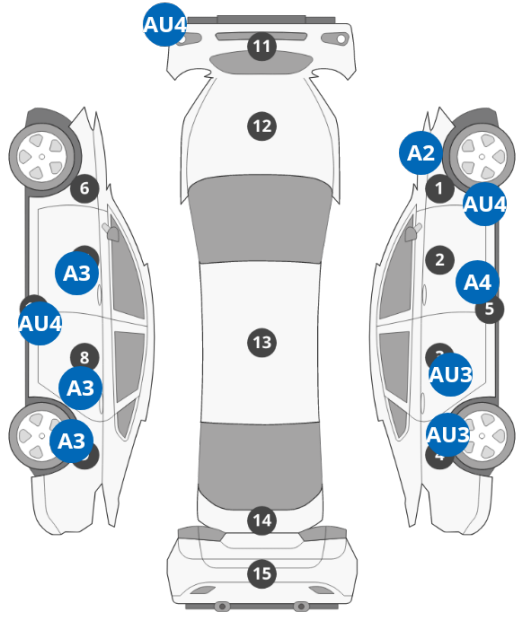
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	96.8	97	95	98
2	Boot Lid	104.0	105	102	105
3	Roof	90.3	91	94	81/95
4	Left Front Fender	85.4	92	83	82
5	Left Front Door	85.6	87	87	83
6	Center Panel Left				
7	Left Rear Door	86.3	88	83	89
8	Left Back Panel	99.9	100	99	101
9	Right Front Fender	91.4	93	92	90
10	Right Front Door	91.3	91	90	92
11	Center Panel Right				
12	Right Rear Door	93.6	93	91	97
13	Right Back Panel	92.8	92	92	95

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Grime - Medium / Mat Other - Grime - Medium / Overall Interior - Smell - Yes	Remarks (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with warranty booklet and LTO plate/ incomplete tools/with jack and spare tire/