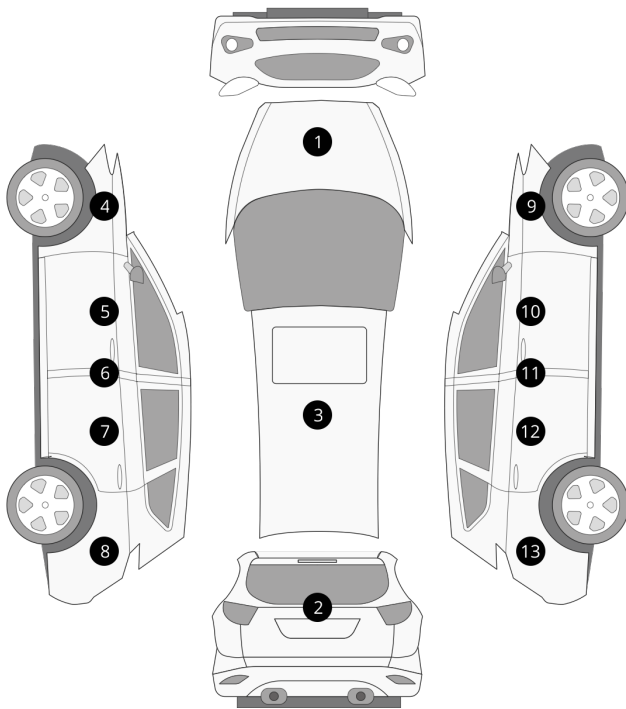


General Information

Date & Time: 05, Aug, 2025 10:25

Make	Toyota	Model	Innova
YOM	2025	Odo Meter Reading	4,497
Registration No.	NJE1950	Chassis No.	PA2JABEMXR01469650
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



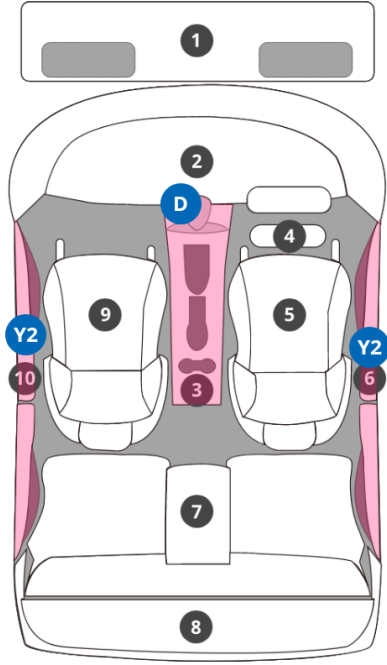
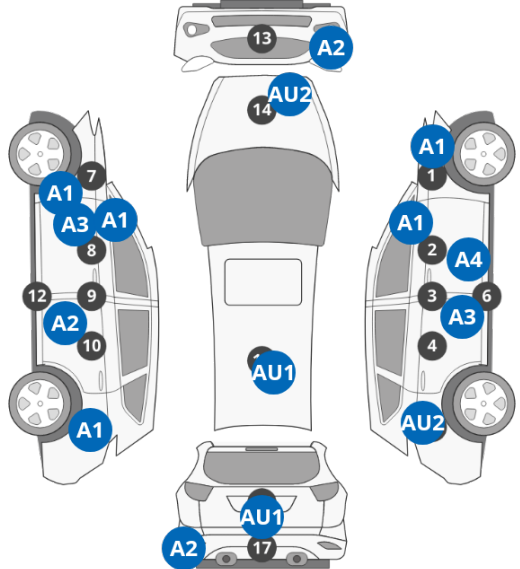
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	109	111	112
2	Boot Lid	111.6	109	118	108
3	Roof	109.7	106	111	109/113
4	Left Front Fender	110.3	110	110	111
5	Left Front Door	122.0	115	128	123
6	Center Panel Left				
7	Left Rear Door	107.6	113	103	107
8	Left Back Panel	111.3	114	108	112
9	Right Front Fender	118.3	125	108	122
10	Right Front Door	120.0	118	126	116
11	Center Panel Right				
12	Right Rear Door	114.6	114	116	114
13	Right Back Panel	111.3	114	110	110

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Console, Switches, Vents - Traces of Adhesive Tape - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch & Dent - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light, IRREGULAR VS FORM / ORCR UNAVAILABLE