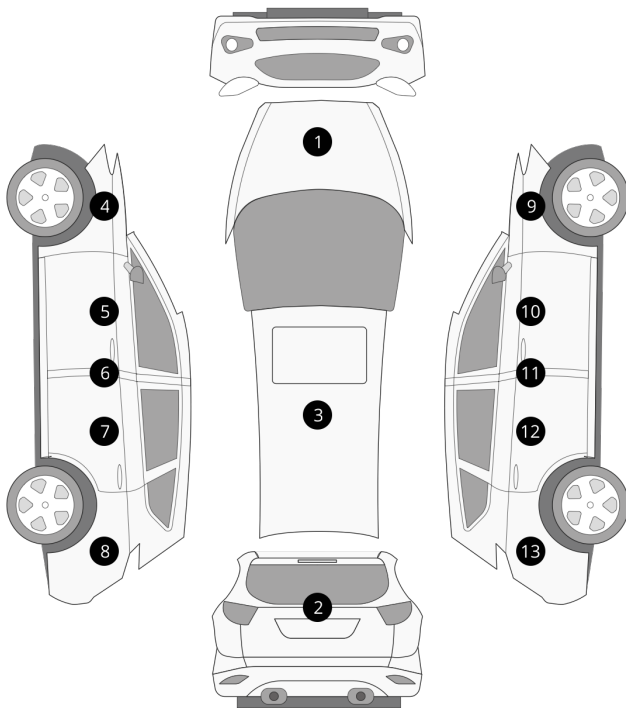


General Information

Date & Time: 07, Aug, 2025 08:53

Make	Chevrolet	Model	Trax
YOM	2017	Odo Meter Reading	55,382
Registration No.	NCM7732	Chassis No.	XL1BA7584GB756693
CC	1.3	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



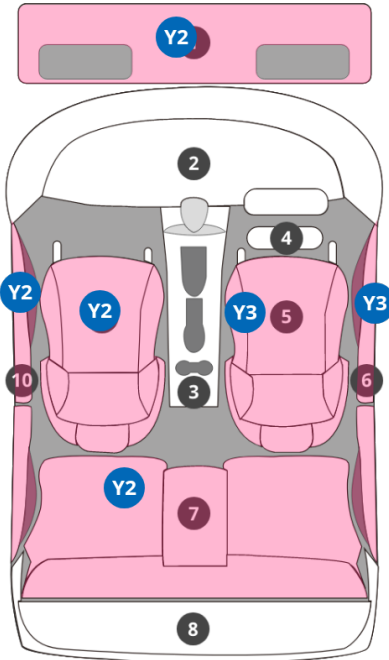
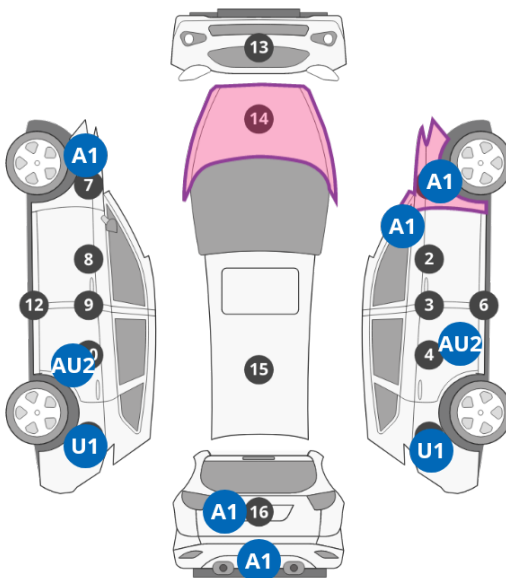
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	190.6	202	202	168
2	Boot Lid	124.0	120	135	117
3	Roof	133.2	130	129	132/142
4	Left Front Fender	135.6	145	131	131
5	Left Front Door	125.6	135	131	111
6	Center Panel Left				
7	Left Rear Door	119.3	115	117	126
8	Left Back Panel	124.6	135	118	121
9	Right Front Fender	191.6	154	211	210
10	Right Front Door	119.0	108	121	128
11	Center Panel Right				
12	Right Rear Door	112.6	121	112	105
13	Right Back Panel	128.3	121	127	137

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B		Exterior Evaluation : B	
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain		 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap	
Remarks (R) Front Trim - Grime - Medium / Rear Seat - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Medium / Ceiling - Grime - Small		Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Dent - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal	
Frame Evaluation : A		Functional Evaluation : B	
Remarks Defects not found		Remarks Battery - Weak - Yes / Head Light, High Beam - Issue - Yes / Spare Key - Issue - Unexist	

Inspector Notes

with LTO plate/with spare/with jack and incomplete tools/headlight issue/No spare key/with warranty booklet /sunvisor glass cover missing