

General Information

Date & Time: 16, Nov, 2024 15:00

Make	Toyota	Model	Wigo
YOM	2023	Mileage	15,288
Registration No.	NHM4614	Chassis No.	MHKAA1BC8PJ003611
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



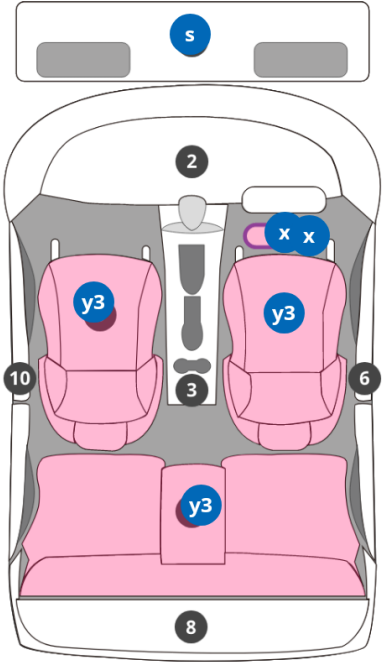
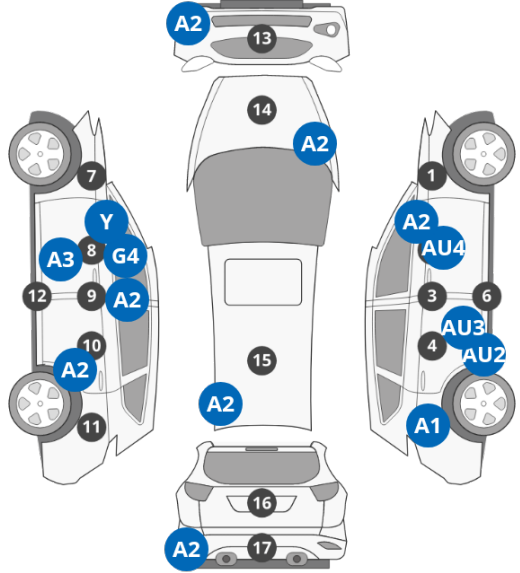
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.6	120	116	117
2	Boot Lid	100.1	98	100	103
3	Roof	84.7	78	94	84/84
4	Left Front Fender	109.0	108	109	110
5	Left Front Door	118.6	105	113	138
6	Center Panel Left				
7	Left Rear Door	101.7	105	103	97
8	Left Back Panel	95.7	97	93	98
9	Right Front Fender	102.2	107	102	98
10	Right Front Door	103.5	111	102	98
11	Center Panel Right				
12	Right Rear Door	109.0	104	105	118
13	Right Back Panel	94.3	92	93	98

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Overall Interior - Smell - Yes	Remarks Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small / (L) Side Window - Scratch, Stone chip - Large / (L) Center Panel - Scratch - Small / (L) Mirror - Crack - Damaged
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

hairline scratches around the exterior. with user manual and warranty booklet. without tools and spare tire.