

General Information

Date & Time: 18, Nov, 2024 09:53

Make	Toyota	Model	Vios
YOM	2023	Mileage	18,571
Registration No.	NIK2217	Chassis No.	PA1B18F34P4204023
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



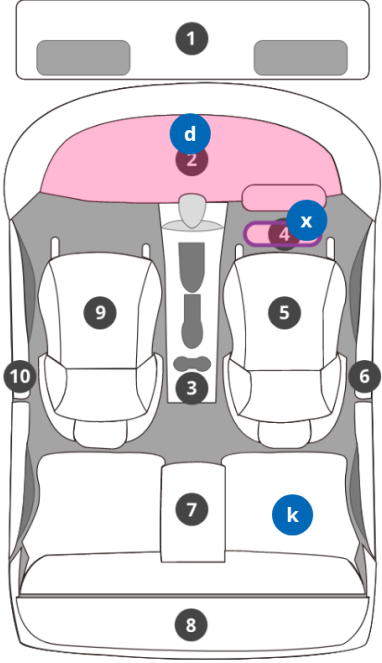
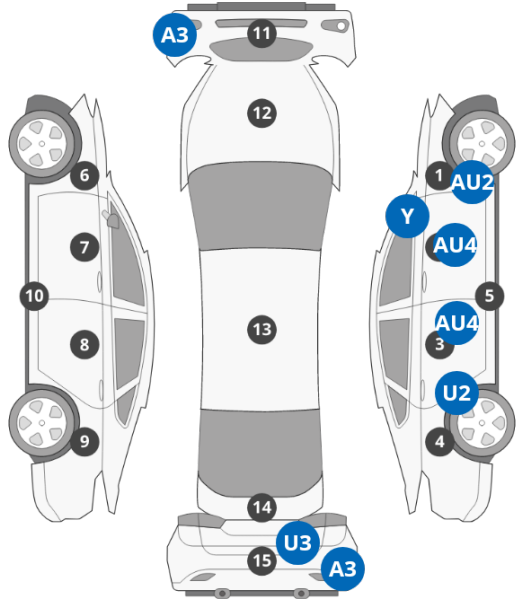
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.6	123	113	120
2	Boot Lid	118.0	109	131	114
3	Roof	106.5	108	104	109/105
4	Left Front Fender	102.4	108	102	97
5	Left Front Door	103.3	104	102	104
6	Center Panel Left				
7	Left Rear Door	107.3	111	104	107
8	Left Back Panel	117.3	115	112	125
9	Right Front Fender	104.1	100	100	113
10	Right Front Door	146.0	160	155	123
11	Center Panel Right				
12	Right Rear Door	97.3	100	96	96
13	Right Back Panel	161.0	145	171	167

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Animal Hair - Yes / (R) Front Floor Mat - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Mirror - Crack - Damaged / (R) Rear Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Dent - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
hanging passenger side mirror / no tools, no jack and warranty booklet