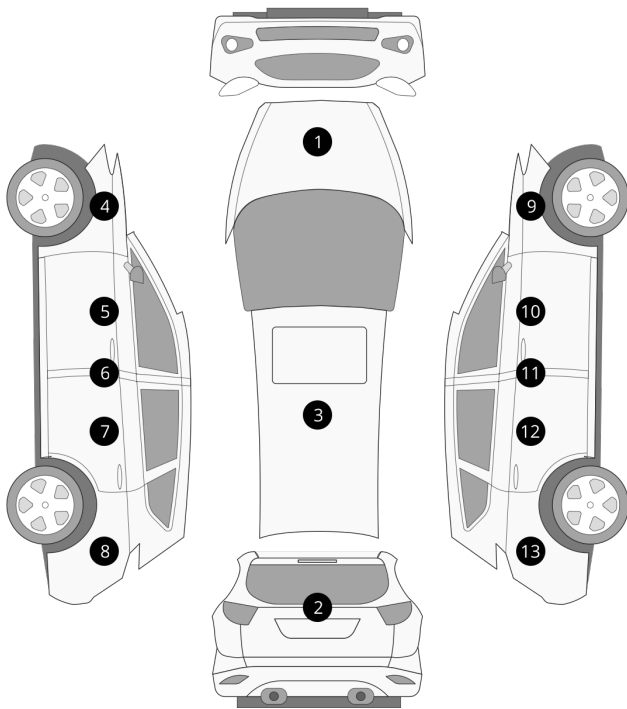


General Information

Date & Time: 08, Aug, 2025 10:08

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	14,272
Registration No.	NKN2926	Chassis No.	PA1B18F30P4217450
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



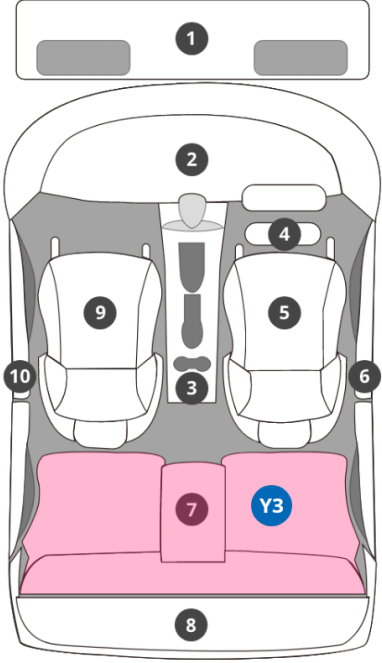
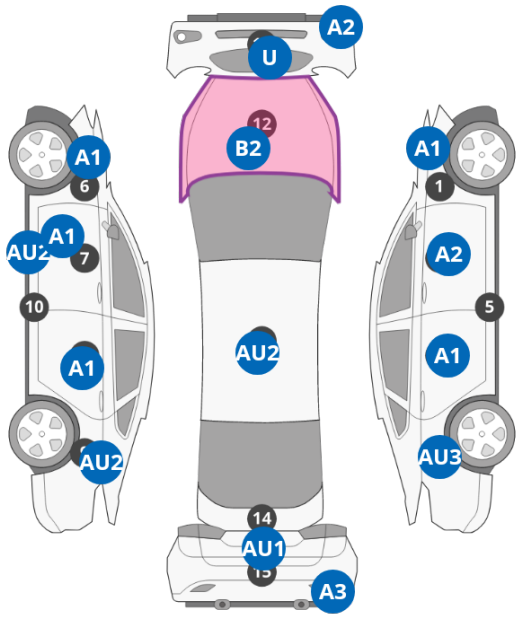
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	171.0	183	177	153
2	Boot Lid	115.3	112	115	119
3	Roof	146.7	144	136	158/149
4	Left Front Fender	100.3	105	97	99
5	Left Front Door	106.0	105	102	111
6	Center Panel Left				
7	Left Rear Door	113.6	120	120	101
8	Left Back Panel	108.6	108	110	108
9	Right Front Fender	99.4	96	100	102
10	Right Front Door	103.0	103	100	106
11	Center Panel Right				
12	Right Rear Door	107.3	102	103	117
13	Right Back Panel	107.3	105	100	117

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium	Remarks Bonnet - Repair Traces - Yes / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Member (Bolted) - Dent - Yes / (R) Rear Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Modified - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

With LTO plate and warranty booklet, Sparetire and Jack, Incomplete Tools. Scratch headlight and tail light, Adhesive marks on vehicle and side mirror, worn tires.