

General Information

Date & Time: 09, Aug, 2025 13:04

Make	Toyota	Model	Innova
YOM	2019	Odo Meter Reading	138,613
Registration No.	CAQ7530	Chassis No.	PA2JA8EM1K9061307
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



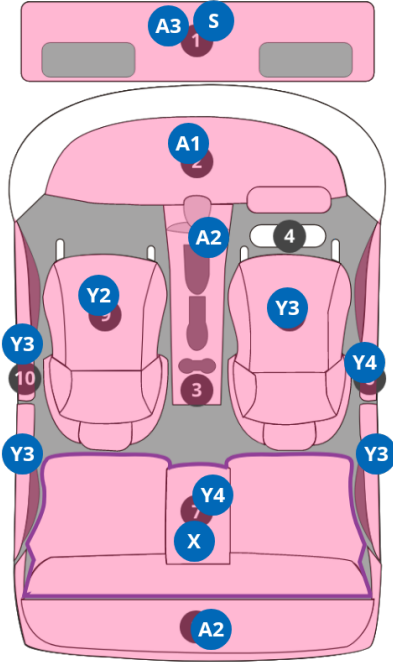
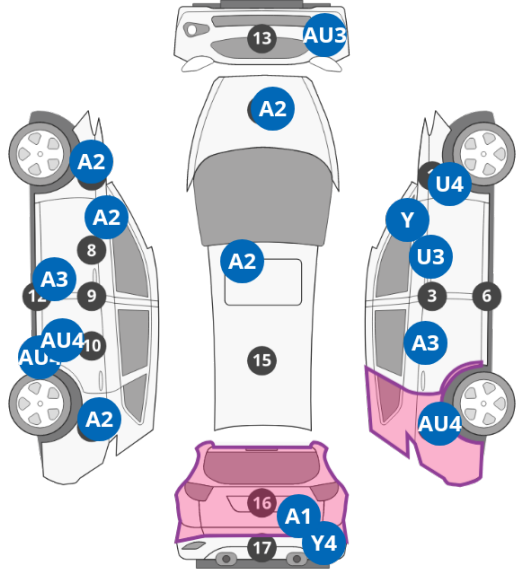
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.6	105	112	100
2	Boot Lid	246.6	128	315	297
3	Roof	96.4	95	89	107/95
4	Left Front Fender	102.6	100	100	108
5	Left Front Door	104.9	106	109	100
6	Center Panel Left				
7	Left Rear Door	122.6	99	172	97
8	Left Back Panel	112.3	107	115	115
9	Right Front Fender	105.3	105	111	100
10	Right Front Door	103.2	97	116	97
11	Center Panel Right				
12	Right Rear Door	168.0	185	164	155
13	Right Back Panel	205.6	202	142	273

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Overall Interior - Smell - Yes / Overall Interior - Worn as per age - Yes / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Medium / (R) Front Trim - Grime - Large / (R) Front Seat - Grime - Medium / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium / Ceiling - Cut, Crack - Medium / (L) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Rear Seat Head Rest - Missing - Yes	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Dent - Large / (R) Front Door, Molding - Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Roof - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / (R) Mirror - Crack - Damaged
Frame Evaluation : D	Functional Evaluation : C
Remarks Right Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire, traces of molds on interior, frontright door issue, busted plate light, missing rear headrest.