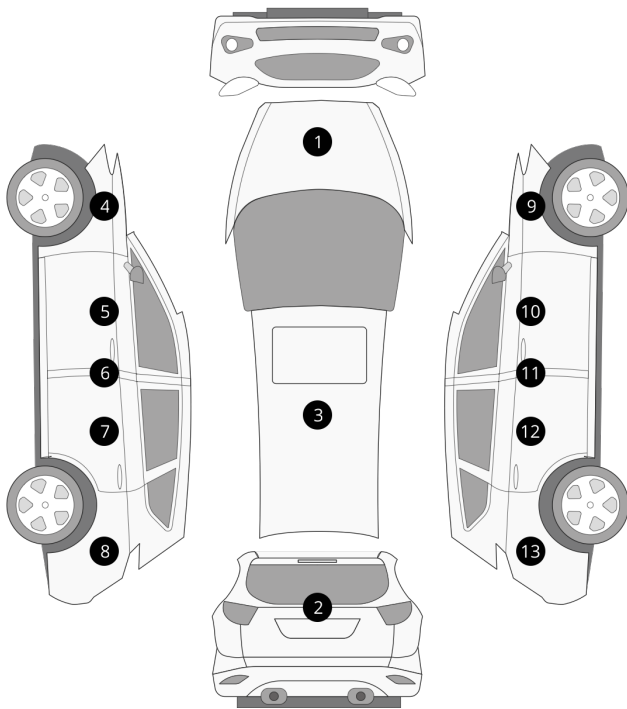


General Information

Date & Time: 08, Aug, 2025 09:26

Make	Toyota	Model	Raize
YOM	2023	Odo Meter Reading	74,179
Registration No.	DAR7816	Chassis No.	MHKAA1BA4NJ051845
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



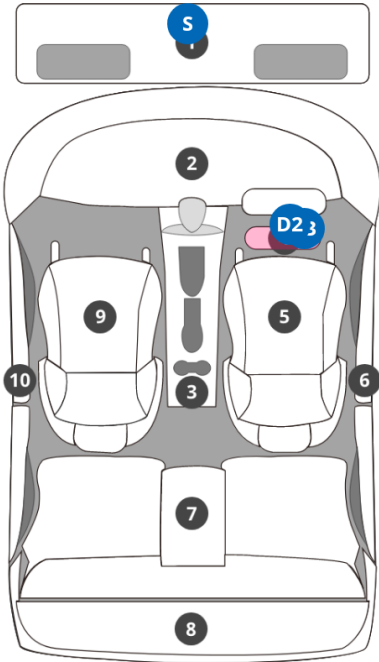
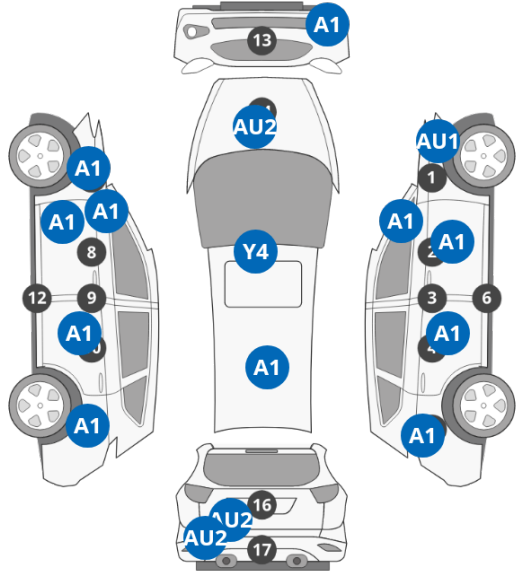
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.3	101	113	105
2	Boot Lid	92.9	91	99	89
3	Roof	94.1	97	102	87/91
4	Left Front Fender	97.3	95	102	95
5	Left Front Door	93.3	91	98	92
6	Center Panel Left				
7	Left Rear Door	94.2	92	100	92
8	Left Back Panel	89.4	89	89	90
9	Right Front Fender	111.3	102	124	108
10	Right Front Door	99.7	98	100	101
11	Center Panel Right				
12	Right Rear Door	99.4	100	98	100
13	Right Back Panel	99.8	111	100	89

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / (L) Front Floor Mat - Grime - Medium / (R) Front Floor Mat - Worked - Small	Remarks Front Windshield - Damaged - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes

Inspector Notes

With LTO plate and Sparetire, Jack. No warranty booklet and Tools, scratch headlight and tail light and Crack front Windshield, Oil deterioration warning. park light and headlight switch won't work properly and suddenly off if you open the lights.