

General Information

Date & Time: 09, Aug, 2025 12:57

Make	Toyota	Model	Hilux
YOM	2024	Odo Meter Reading	41,825
Registration No.	EAG6907	Chassis No.	MR0BA3CD2P0197416
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Red		

Body / Panel Condition



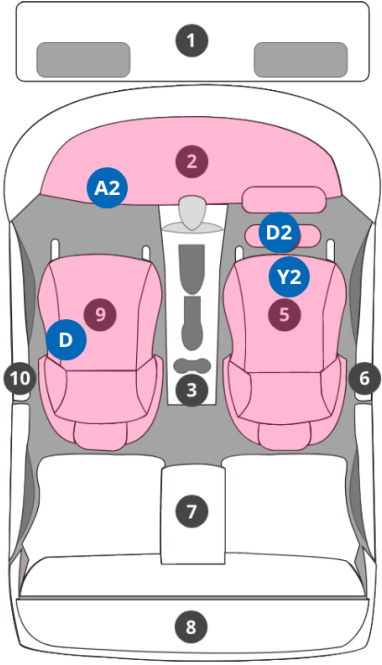
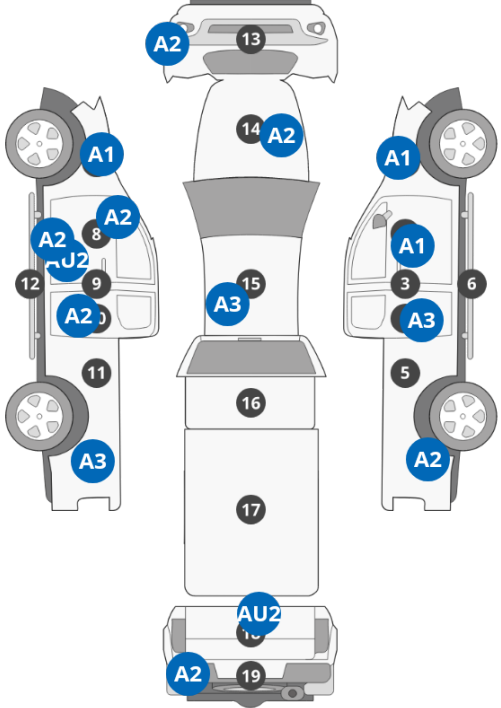
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	128.6	120	134	132
2	Boot Lid	117.3	124	104	124
3	Roof	127.0	135	139	119/115
4	Left Front Fender	112.6	117	110	111
5	Left Front Door	116.6	108	119	123
6	Center Panel Left				
7	Left Rear Door	105.5	107	110	100
8	Left Back Panel	122.0	122	125	119
9	Right Front Fender	114.0	107	125	110
10	Right Front Door	112.6	118	115	105
11	Center Panel Right				
12	Right Rear Door	101.8	104	96	105
13	Right Back Panel	117.6	116	123	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Worked - Small / Steering Wheel - Worn, Peel, Crack - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Medium / (R) Side Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Gate - Scratch & Dent - Small / (L) Side Gate - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, no jack and tools, with spare tire, with LTO plate, scratches on tail light, battery weak