

General Information

Date & Time: 09, Aug, 2025 10:36

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	51,886
Registration No.	NHR8389	Chassis No.	PA1B18F30P4236435
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



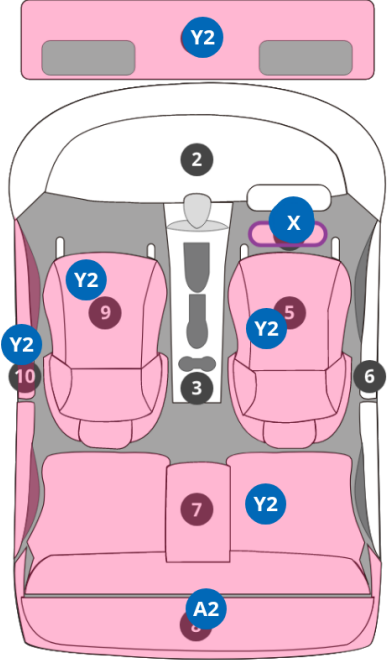
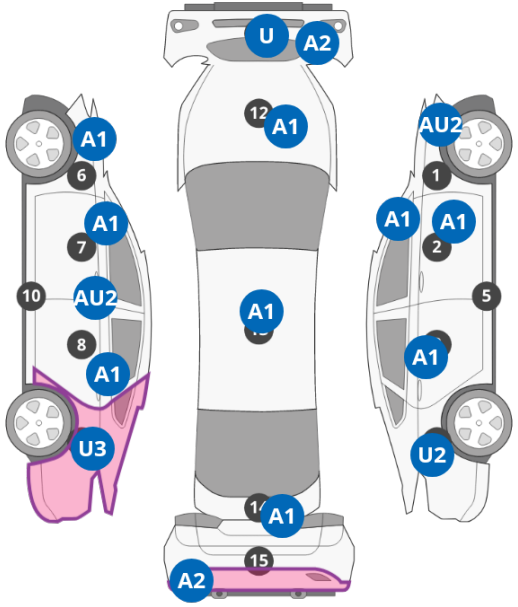
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.0	118	115	118
2	Boot Lid	113.6	115	112	114
3	Roof	109.2	110	114	109/104
4	Left Front Fender	104.2	102	100	111
5	Left Front Door	110.0	112	104	114
6	Center Panel Left				
7	Left Rear Door	109.6	113	105	111
8	Left Back Panel	172.6	188	168	162
9	Right Front Fender	103.3	111	98	101
10	Right Front Door	110.0	117	105	108
11	Center Panel Right				
12	Right Rear Door	119.3	109	130	119
13	Right Back Panel	111.0	111	104	118

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / (L) Front Trim - Grime - Small</p>	<p>Remarks (L) Rear Fender - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Dent - Small / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Dent - Medium / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>with LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire.</p>