

General Information

Date & Time: 09, Aug, 2025 09:50

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	18,821
Registration No.	DBG3327	Chassis No.	PA1B18F38N4199261
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



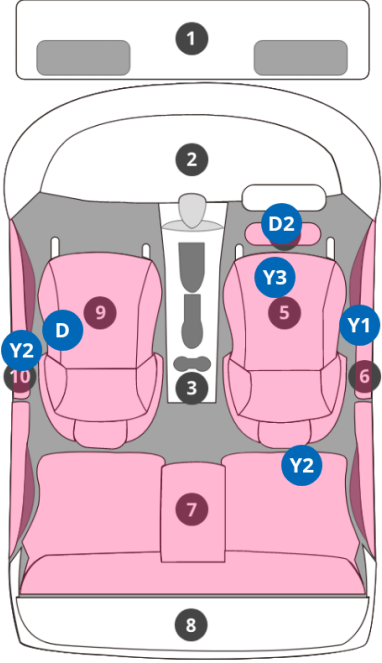
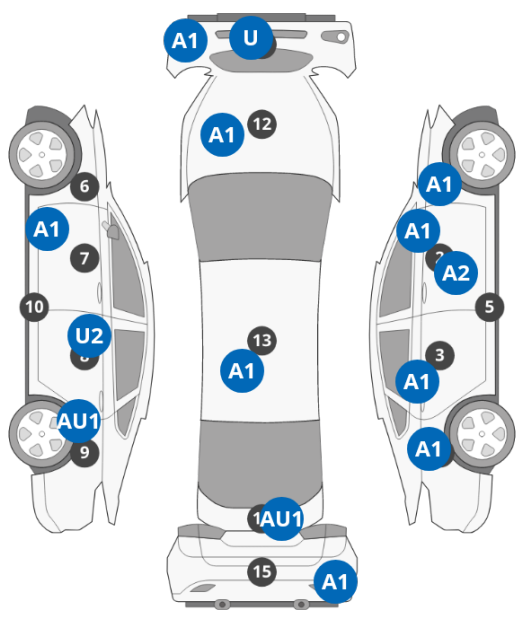
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.4	106	97	125
2	Boot Lid	106.0	98	110	110
3	Roof	104.7	103	111	101/104
4	Left Front Fender	110.9	98	99	135
5	Left Front Door	100.8	100	100	103
6	Center Panel Left				
7	Left Rear Door	104.5	116	104	94
8	Left Back Panel	107.0	113	107	101
9	Right Front Fender	94.1	91	94	98
10	Right Front Door	101.1	109	100	94
11	Center Panel Right				
12	Right Rear Door	99.4	91	95	113
13	Right Back Panel	103.6	102	105	104

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Dent - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes

Inspector Notes
with warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail, retractable mirror issue left side