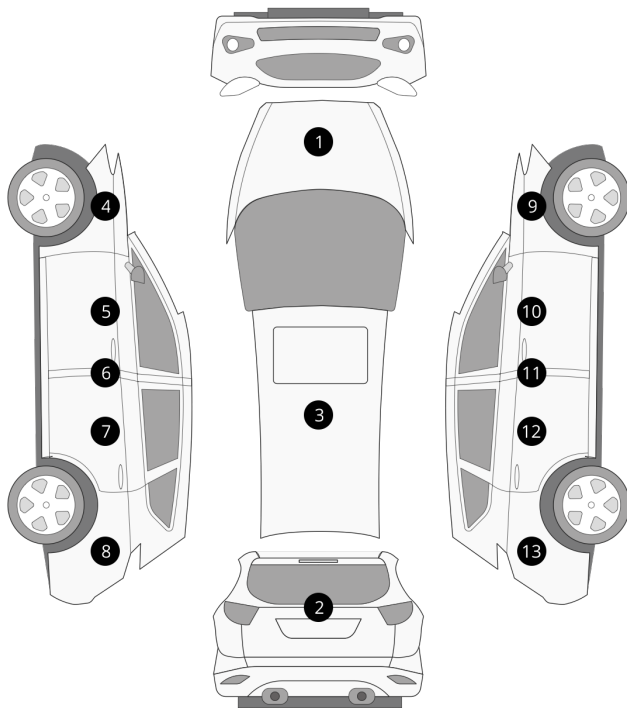


General Information

Date & Time: 09, Aug, 2025 15:21

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	132,613
Registration No.	DBH6428	Chassis No.	PA1B18F31P4208563
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



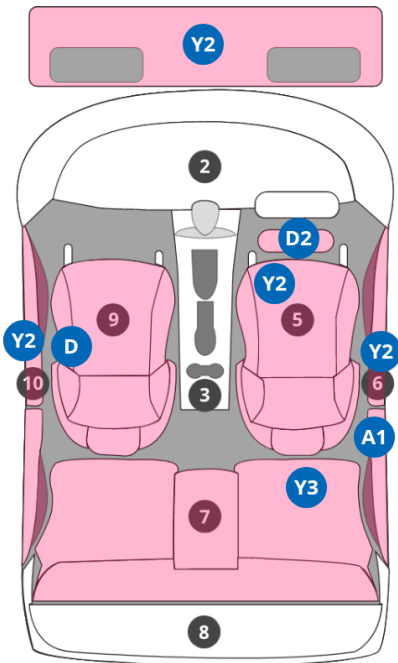
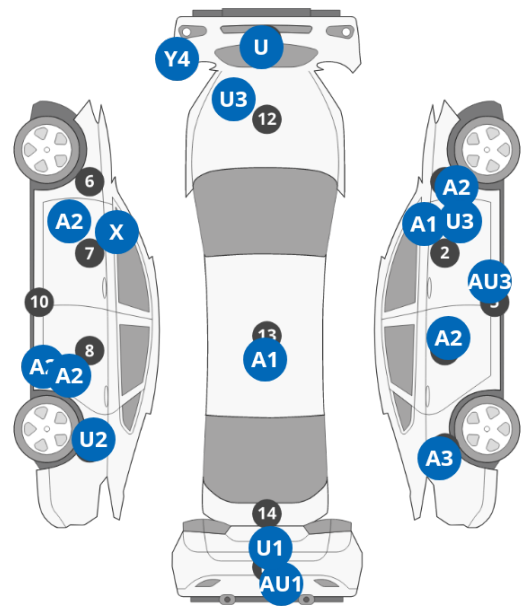
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	115	115	112
2	Boot Lid	106.6	109	102	109
3	Roof	114.6	108	142	97/111
4	Left Front Fender	206.6	195	187	238
5	Left Front Door	175.3	214	162	150
6	Center Panel Left				
7	Left Rear Door	204.3	320	144	149
8	Left Back Panel	182.0	224	158	164
9	Right Front Fender	131.0	148	108	137
10	Right Front Door	189.3	184	195	189
11	Center Panel Right				
12	Right Rear Door	191.6	194	184	197
13	Right Back Panel	105.4	98	107	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / Rear Seat - Grime - Medium / (R) Rear Trim - Cut, Crack - Minimal / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Dent - Minimal / (L) Rear Fender, Molding - Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Stuck - Yes / (L) Front Door, Molding - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Dent - Medium / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Door Lock - Issue - Yes / Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with jack, no tools, no spare tire, with LTO plate, weak battery, power steering issue due to weak battery, scratches on tail light, abnormal noise on engine, door lock issue, room lamp issue