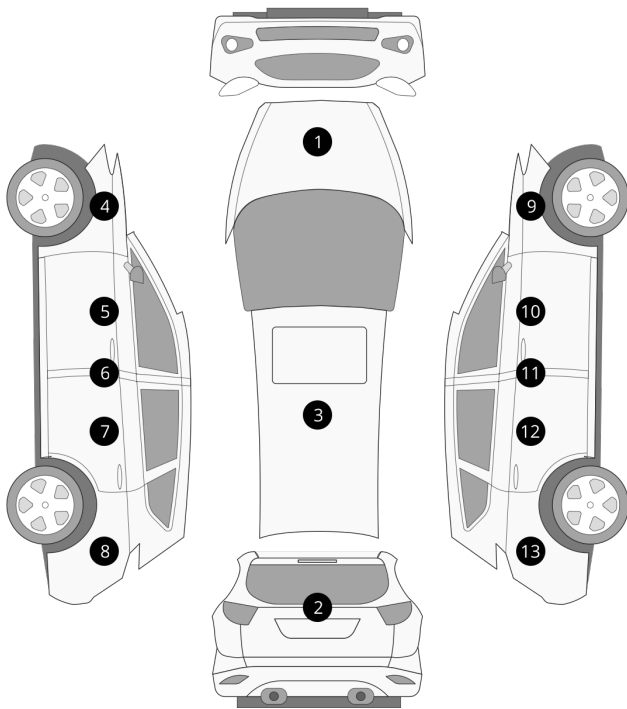


General Information

Date & Time: 13, Aug, 2025 10:24

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	61,151
Registration No.	NGB6719	Chassis No.	PA1B18F37L4123589
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



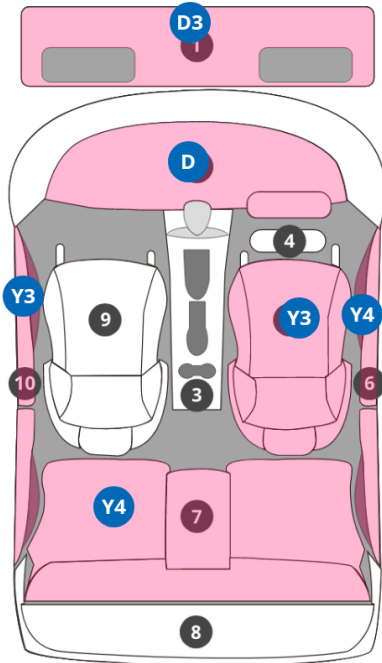
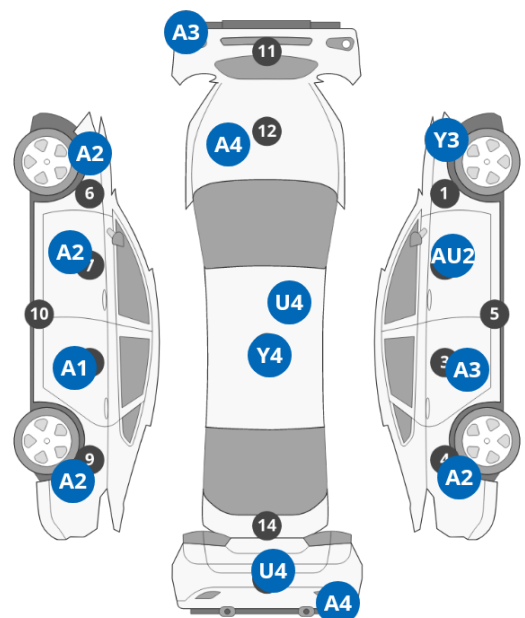
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	96.8	106	92	93
2	Boot Lid	96.5	97	95	97
3	Roof	81.8	82	80	87/79
4	Left Front Fender	83.3	83	86	81
5	Left Front Door	92.3	94	99	85
6	Center Panel Left				
7	Left Rear Door	86.6	94	85	82
8	Left Back Panel	101.0	100	103	100
9	Right Front Fender	88.3	94	90	81
10	Right Front Door	92.3	100	87	91
11	Center Panel Right				
12	Right Rear Door	90.5	85	87	100
13	Right Back Panel	93.1	92	91	96

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Large / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Large / (R) Front Seat - Grime - Medium / Ceiling - Crinkle - Medium	Remarks Bonnet, Headlight - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Dent - Large / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Crack, Gap - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / Roof - Dent - Large / Front Windshield - Damaged - Large
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/No spare /with jack and incomplete tools/engine issue/ No reverse camera /plate light issue/with warranty booklet/HPG recover/non moving vehicle/