

General Information

Date & Time: 09, Aug, 2025 09:47

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	5,143
Registration No.	NFF5056-1	Chassis No.	PA1B18F36P4237718
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



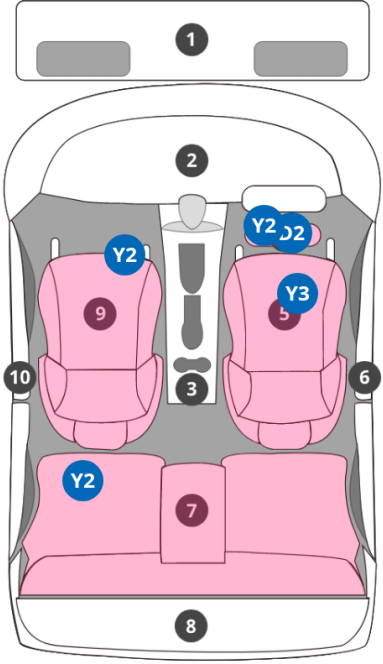
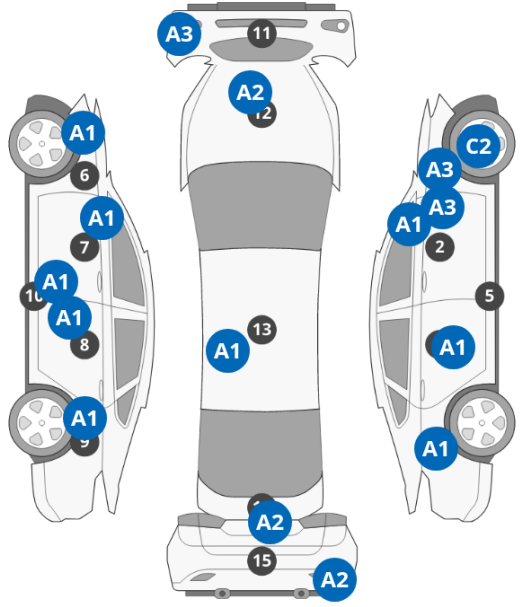
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.6	107	125	118
2	Boot Lid	116.0	118	115	115
3	Roof	112.5	110	117	112/111
4	Left Front Fender	119.0	115	127	115
5	Left Front Door	100.2	100	99	102
6	Center Panel Left				
7	Left Rear Door	117.3	119	116	117
8	Left Back Panel	114.3	106	114	123
9	Right Front Fender	118.3	113	115	127
10	Right Front Door	122.3	102	104	161
11	Center Panel Right				
12	Right Rear Door	106.0	109	105	104
13	Right Back Panel	111.6	113	114	108

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / Mat Other - Crinkle - Small / (R) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / (R) Front Wheel, Cover - Scratch, Corrosion - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Power Steering - Issue - Yes / Reverse Camera - N/A - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire, ABS warning light, power steering issue, TRC warning light.</p>