

General Information

Date & Time: 08, Aug, 2025 08:58

Make	Toyota	Model	Hilux
YOM	2022	Odo Meter Reading	50,225
Registration No.	DAQ5978	Chassis No.	MR0JB8DD4N3540565
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Gray		

Body / Panel Condition



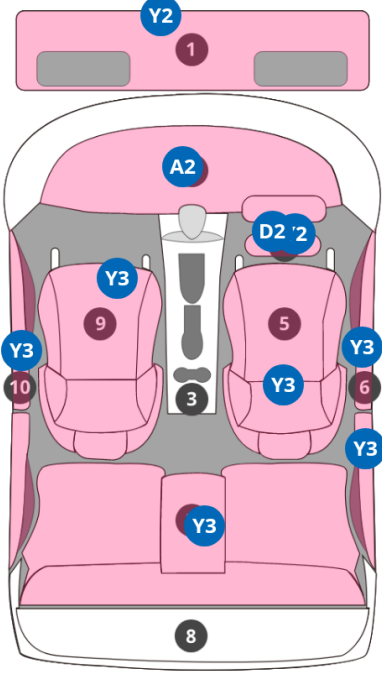
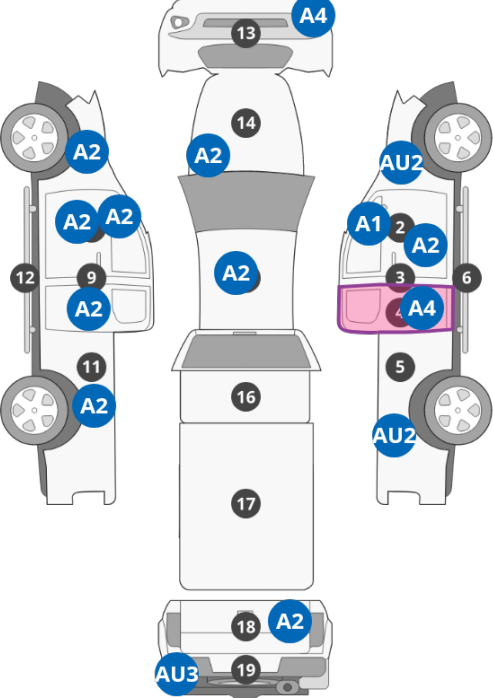
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.6	132	129	113
2	Boot Lid	105.1	114	98	103
3	Roof	117.2	127	118	111/113
4	Left Front Fender	111.0	118	107	108
5	Left Front Door	117.3	108	124	120
6	Center Panel Left				
7	Left Rear Door	110.0	119	105	106
8	Left Back Panel	116.6	104	115	131
9	Right Front Fender	105.3	110	102	104
10	Right Front Door	116.0	122	118	108
11	Center Panel Right				
12	Right Rear Door	107.0	103	102	116
13	Right Back Panel	120.0	129	123	108

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Medium / (R) Front Trim - Grime - Medium / Mat Other - Grime - Small / Overall Interior - Worn as per age - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Large / (R) Side Gate - Scratch & Dent - Small / Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Side Gate - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet, no jack and tools, with LTO plate, scratches on tail light, with spare tire, Original spare tire already installed, Replacement (damaged).