

General Information

Date & Time: 08, Aug, 2025 12:47

Make	Toyota	Model	Innova
YOM	2025	Odo Meter Reading	8,966
Registration No.	NHS8310	Chassis No.	PA2JA8EM5R0147004
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



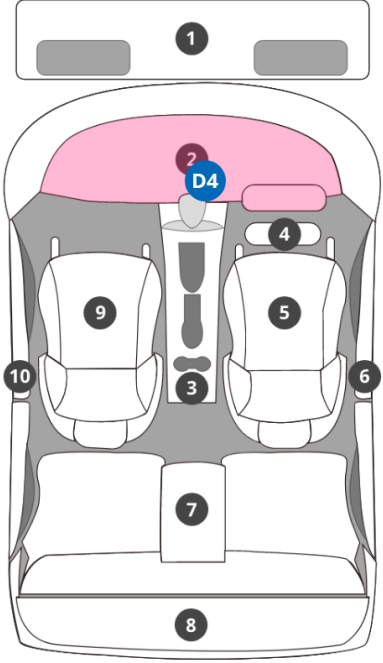
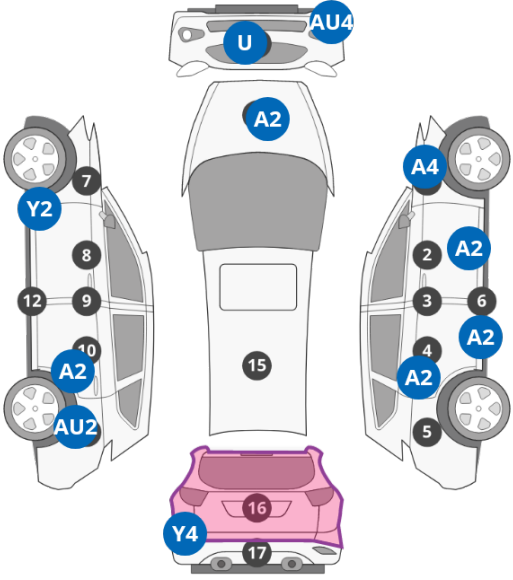
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	107	121	107
2	Boot Lid	201.2	100	386	118
3	Roof	93.8	94	87	94/100
4	Left Front Fender	89.5	97	88	84
5	Left Front Door	95.4	96	95	96
6	Center Panel Left				
7	Left Rear Door	98.1	99	97	99
8	Left Back Panel	104.0	103	103	106
9	Right Front Fender	96.8	87	102	101
10	Right Front Door	97.3	100	100	92
11	Center Panel Right				
12	Right Rear Door	103.2	104	100	106
13	Right Back Panel	104.1	112	103	98

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Dashboard - Loose, Deformed - Large	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Member (Bolted) - Dent - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Crack, Gap - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / Bonnet, Headlight - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Brake Pedal - Function - Weak / Spare Key - Issue - Unexist

Inspector Notes
no radio/ no warranty booklet/no tools/no jack/ warning lamps ; check engine, ABS warning on/ battery issue/ temporary ORCR/ declared as non moving/