

General Information

Date & Time: 12, Aug, 2025 08:56

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	31,125
Registration No.	NFE4180	Chassis No.	PA1B18F38N4181164
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



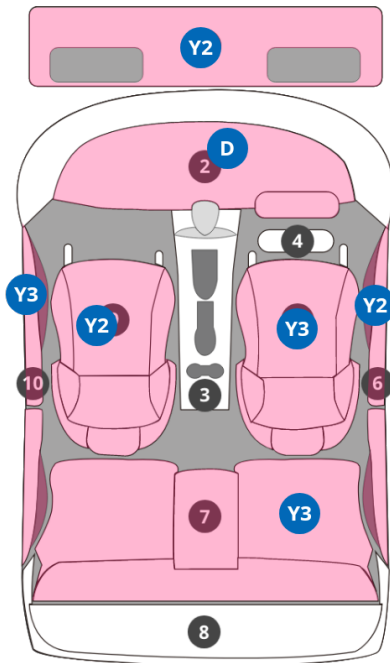
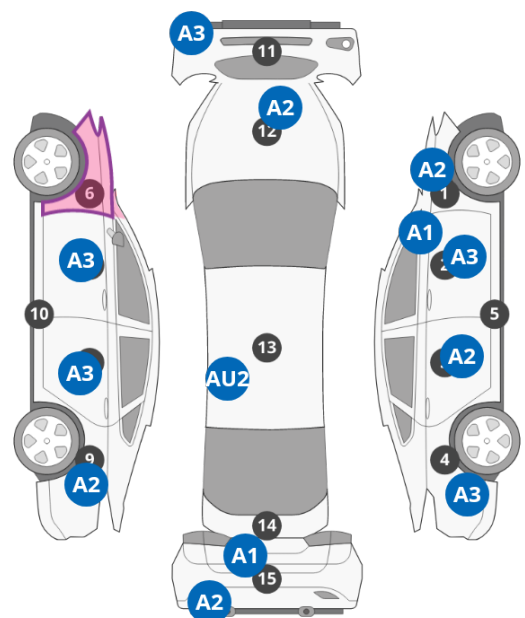
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.6	111	111	110
2	Boot Lid	113.0	109	117	113
3	Roof	94.4	94	99	95/90
4	Left Front Fender	253.0	217	375	167
5	Left Front Door	110.3	109	112	110
6	Center Panel Left				
7	Left Rear Door	109.6	120	102	107
8	Left Back Panel	112.3	115	110	112
9	Right Front Fender	98.2	105	96	94
10	Right Front Door	106.3	106	106	107
11	Center Panel Right				
12	Right Rear Door	106.0	100	105	113
13	Right Back Panel	109.6	101	106	122

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small / Ceiling - Grime - Small / (L) Front Trim - Grime - Medium	Remarks (L) Front Fender - Repair Traces - Yes / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with jack No tools/No reverse camera/rear windshield sealant issue/No spare key/with warranty booklet/