


General Information

Date & Time: 11, Aug, 2025 18:00

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	55,836
Registration No.	NHR4329	Chassis No.	PA1B18F34P4229892
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition

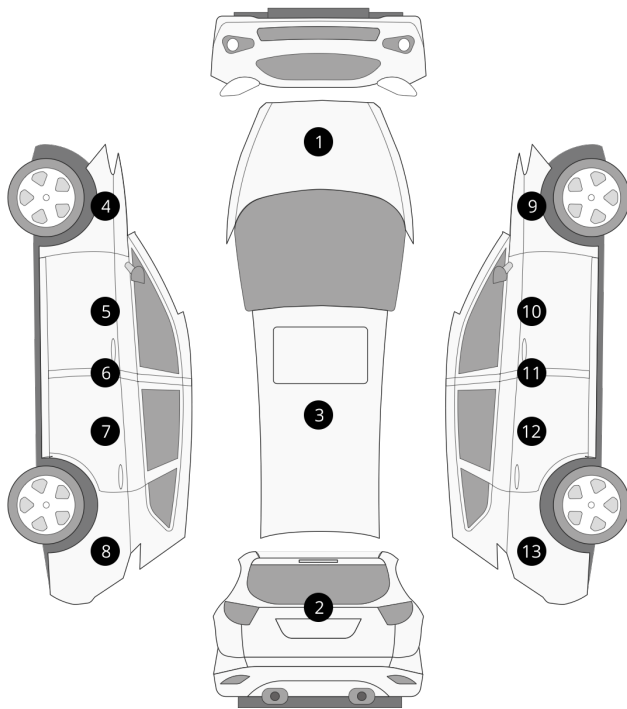

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.4	101	73	112
2	Boot Lid	112.6	110	108	120
3	Roof	110.0	113	113	103/111
4	Left Front Fender	106.0	114	108	96
5	Left Front Door	146.6	160	138	142
6	Center Panel Left				
7	Left Rear Door	113.0	119	118	102
8	Left Back Panel	133.3	124	146	130
9	Right Front Fender	103.6	107	102	102
10	Right Front Door	138.6	132	128	156
11	Center Panel Right				
12	Right Rear Door	107.3	103	101	118
13	Right Back Panel	111.3	112	108	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Medium / Ceiling - Grime - Medium / (R) Front Trim - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Console, Switches, Vents - Traces of Adhesive Tape - Yes	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Dent - Large / (R) Step, In-panel, Side Spoiler - Dent - Medium / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / Roof - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Repair mark - Yes / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire, traces of adhesive on trunk hood, damaged tail light