

General Information

Date & Time: 11, Aug, 2025 17:58

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	92,803
Registration No.	DAQ1329	Chassis No.	PA1B18F3XN4172479
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



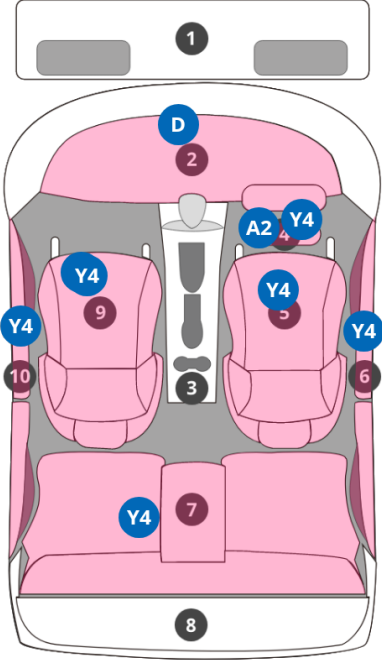
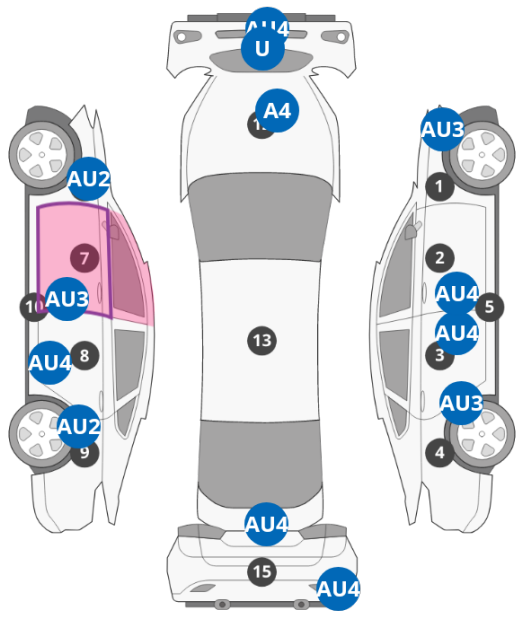
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	102	118	115
2	Boot Lid	112.0	108	107	121
3	Roof	104.5	102	101	112/103
4	Left Front Fender	110.0	133	98	100
5	Left Front Door	111.6	113	114	108
6	Center Panel Left				
7	Left Rear Door	110.0	102	114	114
8	Left Back Panel	172.6	184	187	147
9	Right Front Fender	365.0	131	506	458
10	Right Front Door	121.6	109	105	151
11	Center Panel Right				
12	Right Rear Door	111.6	107	115	113
13	Right Back Panel	104.0	108	100	104

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Smell - Yes / (L) Front Seat - Grime - Large / (L) Front Floor Mat - Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / Mat Other - Grime - Large / (R) Front Trim - Grime - Large / (L) Front Trim - Grime - Large	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Large / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Repair mark - Difference in Color / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Large
Frame Evaluation : A	Functional Evaluation : E
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Power Steering - Issue - Yes / Shift Shock - Function - Weak / Battery - Weak - Yes / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/ incomplete tools/ possible flooding/ no jack / with sparetire and LTO plate