


General Information

Date & Time: 13, Aug, 2025 07:46

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	47,306
Registration No.	HAC6468	Chassis No.	PA1B18F36L4131389
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition

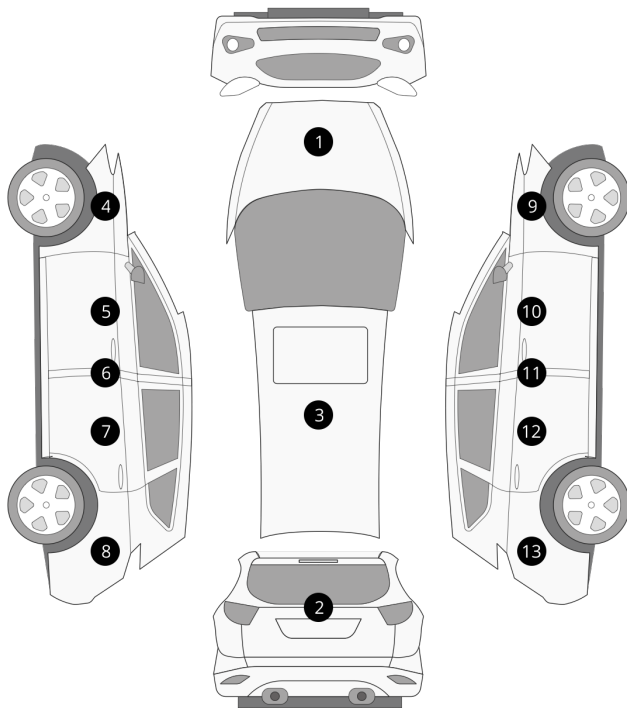


#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.6	101	104	112
2	Boot Lid	94.6	94	93	97
3	Roof	86.0	93	80	91/80
4	Left Front Fender	90.1	86	87	97
5	Left Front Door	93.9	94	96	92
6	Center Panel Left				
7	Left Rear Door	93.6	94	93	93
8	Left Back Panel	104.3	110	102	101
9	Right Front Fender	92.1	99	87	91
10	Right Front Door	89.0	89	87	91
11	Center Panel Right				
12	Right Rear Door	88.3	87	86	93
13	Right Back Panel	96.2	93	94	102

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

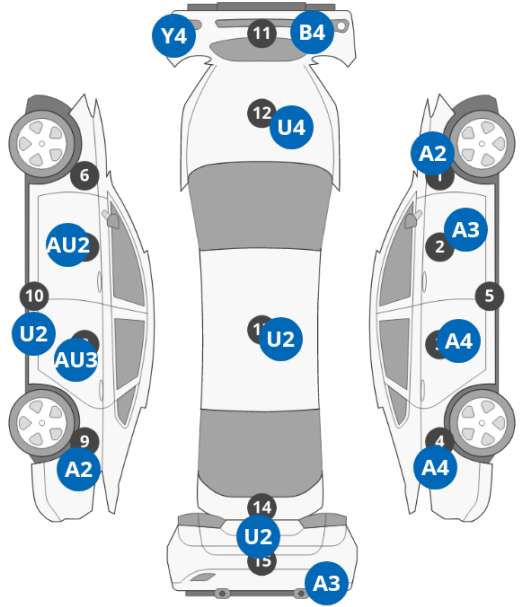Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Trunk Room - Worn, Scratch, Cut, Crack - Small	Remarks (R) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Modified - Large / (R) Front Door, Molding - Scratch - Medium / Roof - Dent - Small / Trunk Hood, Rear Gate - Dent - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/No jack and tools/No warranty booklet/front right side bumper partial parts missing/ No horn /No spare key/with reverse camera