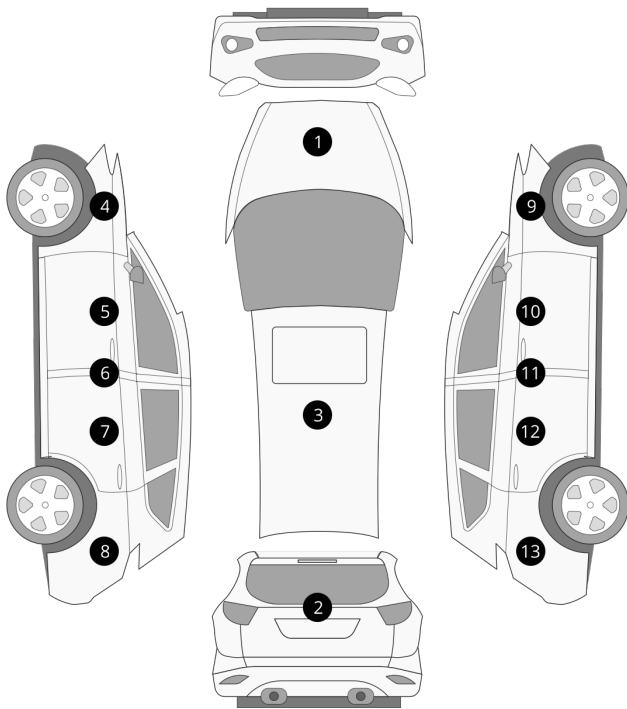


General Information

Date & Time: 12, Aug, 2025 13:33

Make	Toyota	Model	Fortuner
YOM	2022	Odo Meter Reading	69,460
Registration No.	NFI2883	Chassis No.	MHFCB8GS6M0521456
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Gray		

Body / Panel Condition



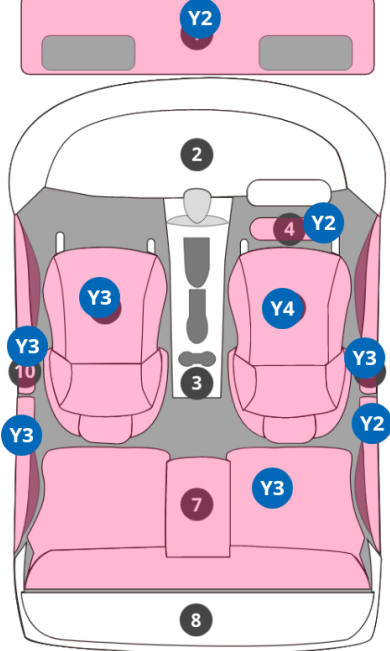
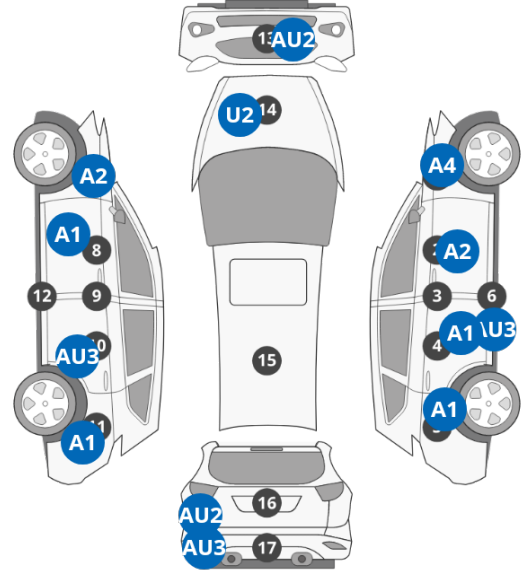
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.0	100	114	107
2	Boot Lid	92.4	85	105	88
3	Roof	114.7	116	122	114/107
4	Left Front Fender	97.3	90	94	108
5	Left Front Door	103.3	108	102	100
6	Center Panel Left				
7	Left Rear Door	94.6	104	95	85
8	Left Back Panel	106.3	113	103	103
9	Right Front Fender	144.0	139	135	158
10	Right Front Door	105.3	105	108	103
11	Center Panel Right				
12	Right Rear Door	99.9	86	106	108
13	Right Back Panel	107.6	109	101	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Large / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Medium / (R) Rear Trim - Grime - Small / (L) Rear Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium	Remarks (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

HPG RECOVERED VEHICLE. Horn issue. Engine oil level low indicated at the instrument panel. With warranty booklet, spare tire, jack and tools. 1 key. With LTO plate.