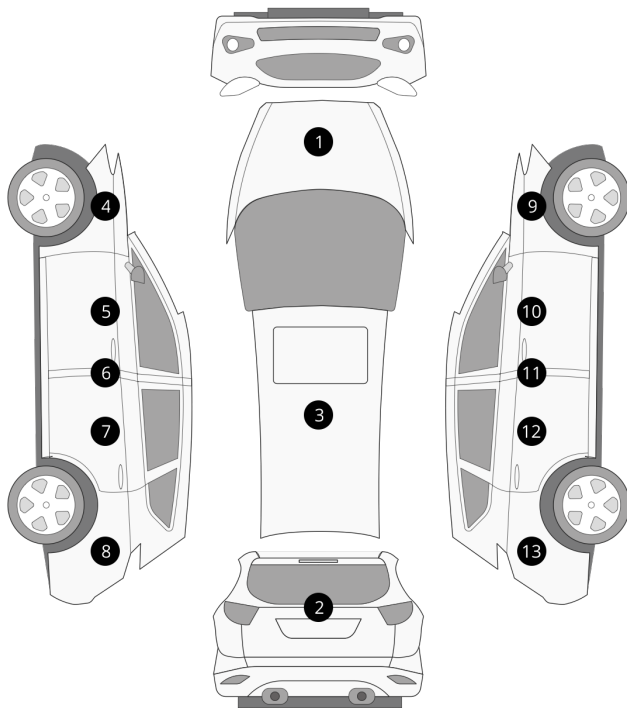


General Information

Date & Time: 12, Aug, 2025 14:57

Make	Toyota	Model	Hilux
YOM	2021	Odo Meter Reading	156,128
Registration No.	NGT2132	Chassis No.	MR0AB8DD7L5133907
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Black		

Body / Panel Condition



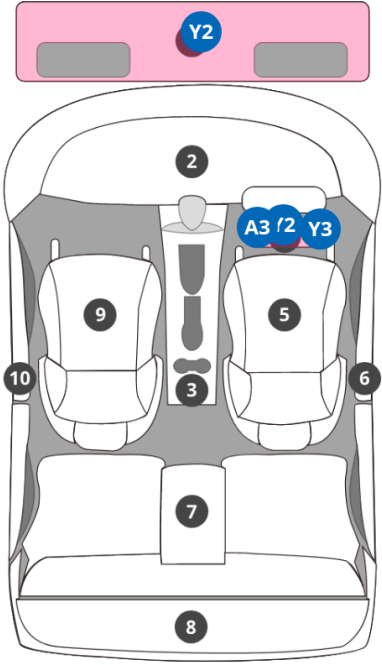
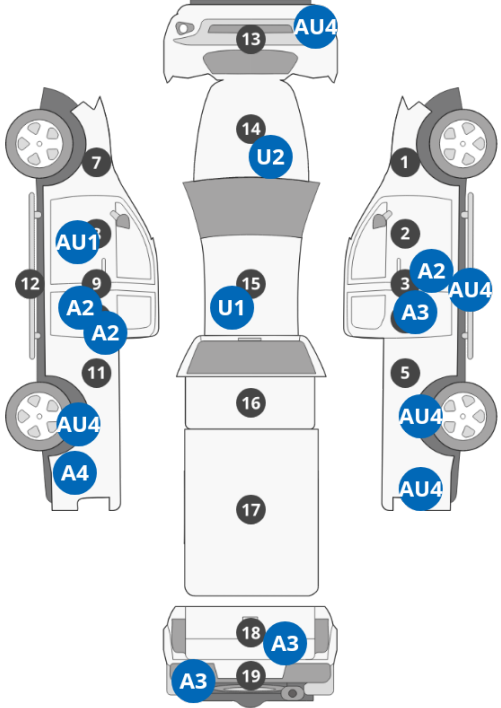
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	119.6	120	120	119
2	Boot Lid	98.7	98	99	100
3	Roof	126.7	115	114	141/137
4	Left Front Fender	106.0	102	106	110
5	Left Front Door	116.6	114	123	113
6	Center Panel Left				
7	Left Rear Door	105.3	110	106	100
8	Left Back Panel	114.6	109	120	115
9	Right Front Fender	107.3	106	108	108
10	Right Front Door	117.0	119	117	115
11	Center Panel Right				
12	Right Rear Door	104.3	100	107	106
13	Right Back Panel	118.0	113	128	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Floor Mat - Grime - Medium / Mat Other - Grime - Small / (L) Front Floor Mat - Cut, Crack - Medium	Remarks (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Corner Panel - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Bonnet, Headlight - Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Rear Gate - Scratch - Medium / (R) Side Gate - Scratch & Dent - Large / (L) Side Gate - Scratch - Large / (L) Guard Frame - Scratch & Dent - Large / (R) Guard Frame - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / Roof - Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

Plate light issue. Without warranty booklet and tools. With spare tire and jack. 1 key. With LTO plate.