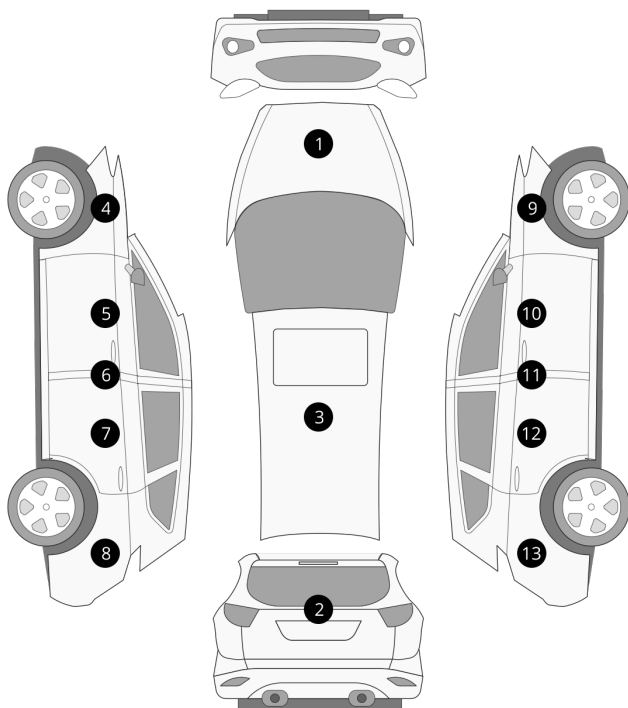


General Information

Date & Time: 12, Aug, 2025 10:44

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	25,593
Registration No.	NGU1654	Chassis No.	PA1B18F33M4133814
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



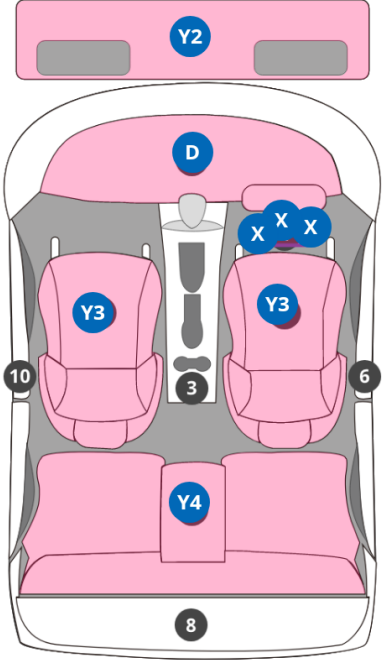
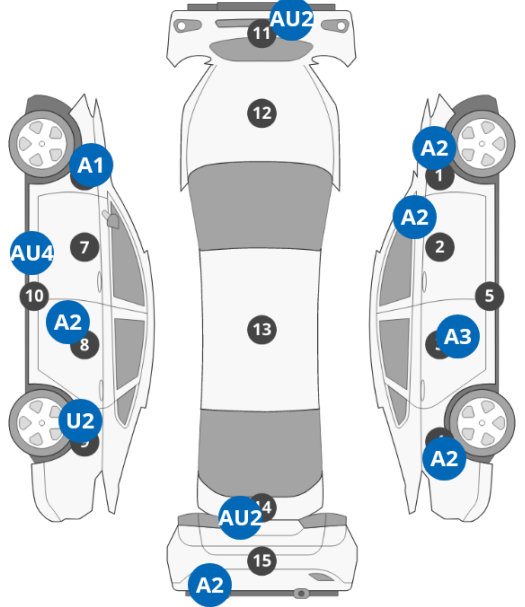
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	152.0	151	156	149
2	Boot Lid	118.3	124	115	116
3	Roof	122.3	141	133	117/98
4	Left Front Fender	122.3	127	120	120
5	Left Front Door	125.3	131	119	126
6	Center Panel Left				
7	Left Rear Door	121.6	137	117	111
8	Left Back Panel	132.3	140	130	127
9	Right Front Fender	136.0	132	139	137
10	Right Front Door	93.1	101	92	86
11	Center Panel Right				
12	Right Rear Door	105.0	105	101	109
13	Right Back Panel	119.0	114	112	131

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Large / (L) Front Seat - Grime - Medium / Ceiling - Grime - Small	Remarks (R) Rear Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
Trunk floor missing. Rusted bolts at seat railings. without warranty booklet and tools. with spare tire and jack. 1 key. With LTO plate.