

General Information

Date & Time: 12, Aug, 2025 15:08

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	29,866
Registration No.	NIH2672	Chassis No.	PA1B18F35N4199296
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



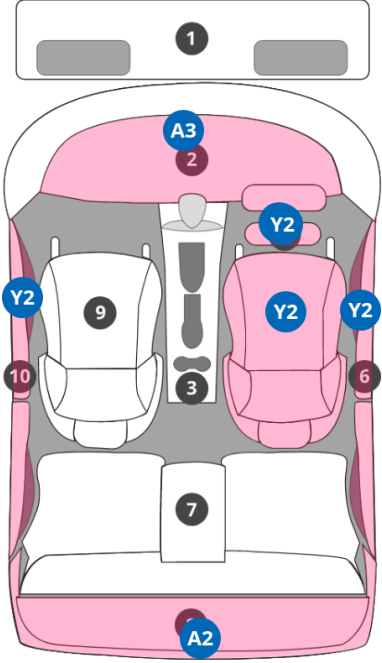
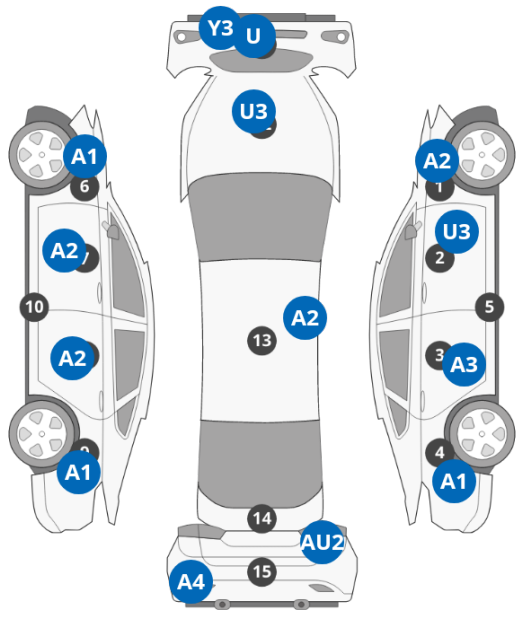
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	127.0	142	113	126
2	Boot Lid	94.9	92	96	97
3	Roof	91.2	92	93	82/98
4	Left Front Fender	97.4	96	95	101
5	Left Front Door	109.0	103	128	96
6	Center Panel Left				
7	Left Rear Door	100.9	104	100	99
8	Left Back Panel	98.2	101	93	101
9	Right Front Fender	89.5	93	90	86
10	Right Front Door	94.5	100	92	92
11	Center Panel Right				
12	Right Rear Door	93.2	88	89	103
13	Right Back Panel	96.9	95	96	100

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Grime - Medium / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Small / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Medium	Remarks Member (Bolted) - Dent - Yes / Bonnet, Headlight - Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (L) Front Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (R) Front Door, Molding - Dent - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Minimal / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with jack and tools/No spare key/Left side tail lights housing crack/ reverse camera not working/with warranty booklet