

General Information

Date & Time: 12, Aug, 2025 12:46

Make	Toyota	Model	Fortuner
YOM	2023	Odo Meter Reading	19,946
Registration No.	NIM5647	Chassis No.	MHFCB8GS9P3527447
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	White		

Body / Panel Condition



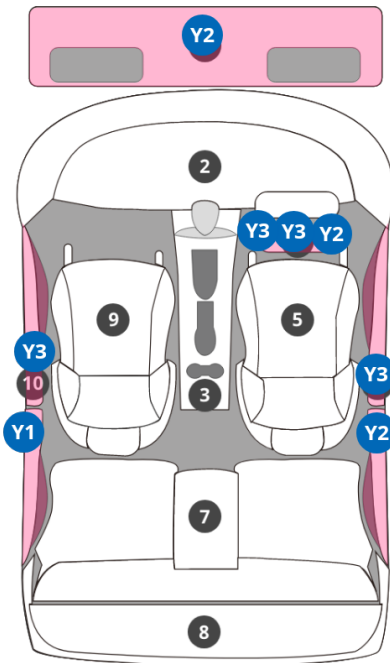
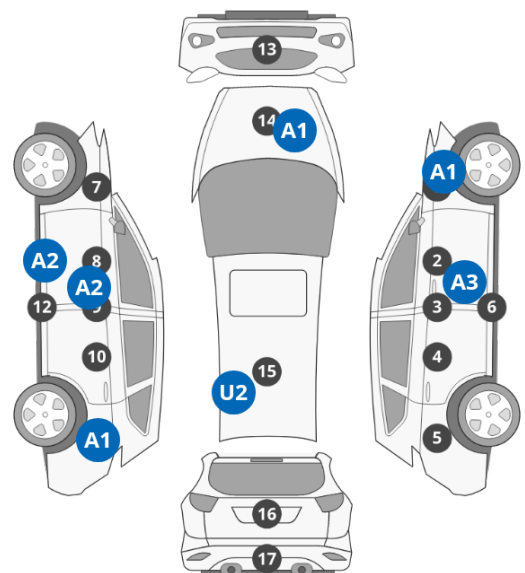
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	264.3	267	274	252
2	Boot Lid	201.3	212	190	202
3	Roof	249.0	247	287	266/196
4	Left Front Fender	232.3	213	242	242
5	Left Front Door	216.0	187	205	256
6	Center Panel Left				
7	Left Rear Door	201.0	205	208	190
8	Left Back Panel	234.0	229	243	230
9	Right Front Fender	222.3	246	212	209
10	Right Front Door	165.0	173	163	159
11	Center Panel Right				
12	Right Rear Door	179.0	182	166	189
13	Right Back Panel	221.6	235	201	229

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Floor Mat - Grime - Small / (R) Rear Trim - Grime - Small / Mat Other - Grime - Medium / (L) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Medium	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes

With warranty booklet, spare tire, jack and tools. 1 key. With LTO plate.