

General Information

Date & Time: 12, Aug, 2025 15:33

Make	Toyota	Model	Innova
YOM	2023	Odo Meter Reading	66,565
Registration No.	NIP3260	Chassis No.	PA2JA8EM9P0126114
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



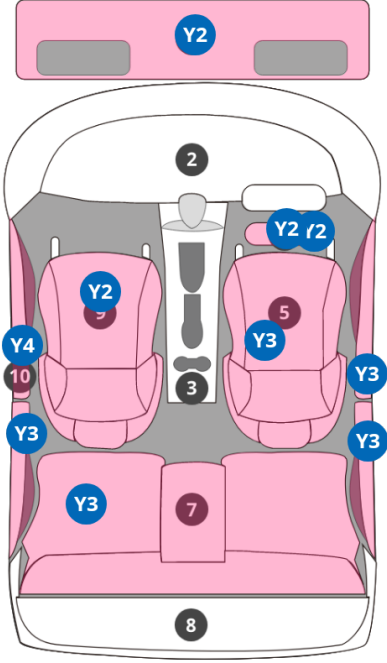
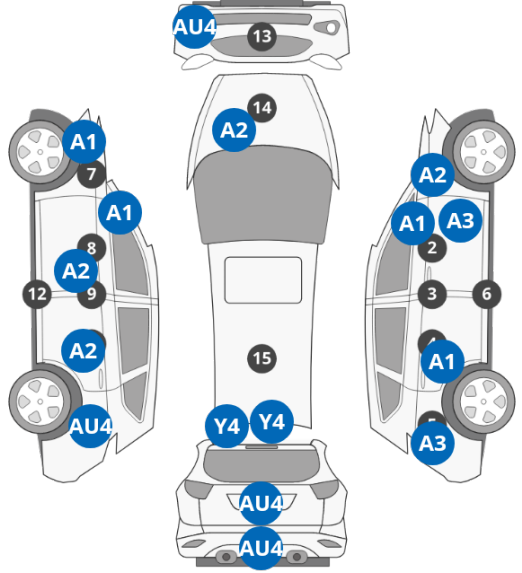
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	111	109	107
2	Boot Lid	117.3	116	126	110
3	Roof	92.0	103	80	91/94
4	Left Front Fender	94.6	111	98	75
5	Left Front Door	69.6	69	64	76
6	Center Panel Left				
7	Left Rear Door	133.3	138	130	132
8	Left Back Panel	102.3	105	102	100
9	Right Front Fender	99.6	93	102	104
10	Right Front Door	99.1	93	108	97
11	Center Panel Right				
12	Right Rear Door	163.6	176	155	160
13	Right Back Panel	104.6	105	107	102

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Medium / (R) Rear Trim - Grime - Medium / Mat Other - Grime - Small / (L) Rear Trim - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Small	Remarks (L) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof Spoiler, Molding - Crack, Gap - Large / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Rear Windshield - Damaged - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak

Inspector Notes
Damaged Rear Windshield, rear bumper, trunk door, roof spoiler and rear left fender. Low battery. Crack taillight. Taillight and hazard lights issue. Cannot confirm if with Jack and tools due of cannot open trunk door. With warranty booklet and spare tire. 2 keys. With LTO plate.