

General Information

Date & Time: 11, Aug, 2025 15:31

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	9,401
Registration No.	DBM5583	Chassis No.	MHKAA1BC4RJ015208
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



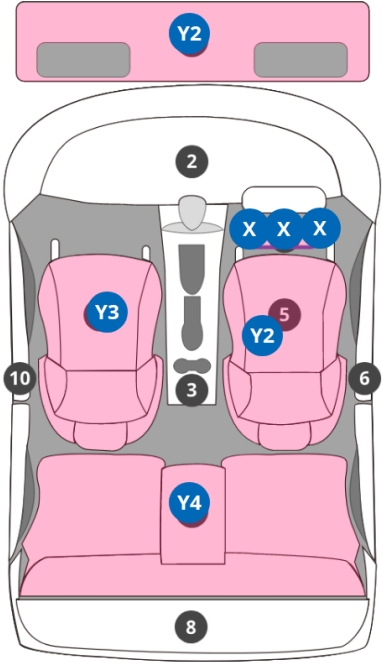
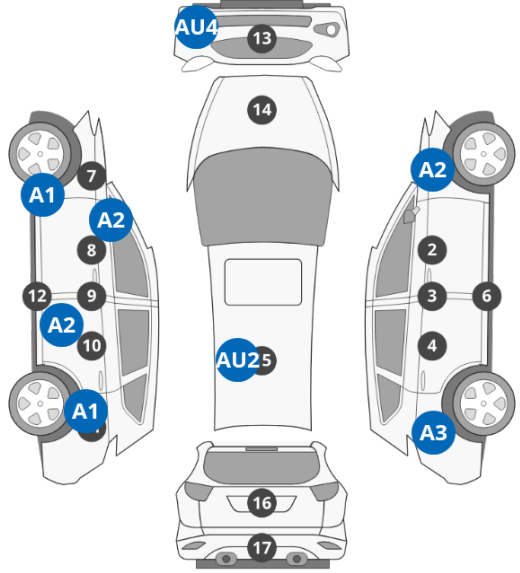
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	171.3	180	165	169
2	Boot Lid	107.3	106	110	106
3	Roof	115.7	124	131	115/93
4	Left Front Fender	135.0	124	149	132
5	Left Front Door	150.6	154	147	151
6	Center Panel Left				
7	Left Rear Door	136.0	143	136	129
8	Left Back Panel	123.3	115	129	126
9	Right Front Fender	135.6	144	135	128
10	Right Front Door	149.3	172	143	133
11	Center Panel Right				
12	Right Rear Door	184.6	153	172	229
13	Right Back Panel	109.3	106	106	116

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Small / Rear Seat - Grime - Large / (L) Front Seat - Grime - Medium	Remarks Bonnet - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Scratch & Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
Without warranty booklet,jack and tools. With spare tire. 1 key. With LTO plate.