

General Information

Date & Time: 12, Aug, 2025 12:37

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	24,679
Registration No.	NKA3696-1	Chassis No.	PA1B183XR4245971
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



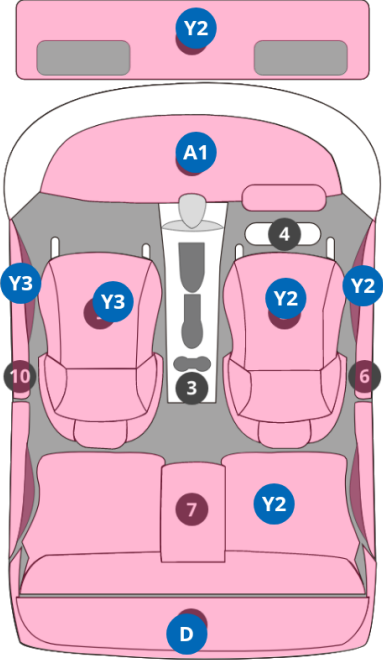
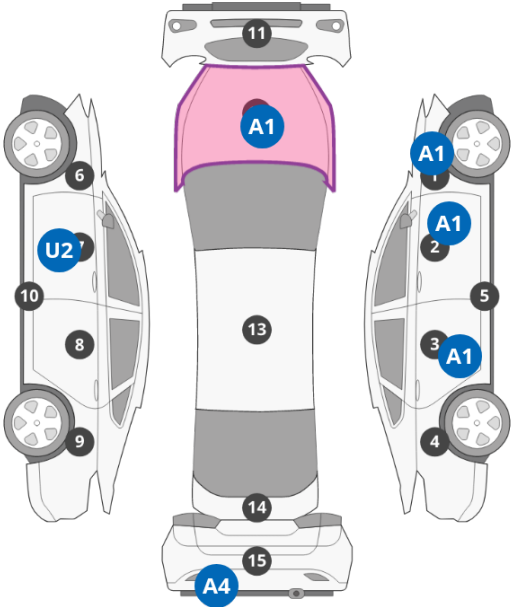
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	205.3	207	205	204
2	Boot Lid	120.3	117	117	127
3	Roof	130.5	146	143	117/116
4	Left Front Fender	125.3	128	118	130
5	Left Front Door	132.0	127	140	129
6	Center Panel Left				
7	Left Rear Door	136.0	138	132	138
8	Left Back Panel	131.3	138	124	132
9	Right Front Fender	143.3	150	143	137
10	Right Front Door	114.0	115	117	110
11	Center Panel Right				
12	Right Rear Door	124.0	115	134	123
13	Right Back Panel	125.3	125	126	125

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Trim - Grime - Small / Trunk Room - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Medium / (L) Front Trim - Grime - Medium / Ceiling - Grime - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Front Door, Molding - Dent - Small / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering Pump - Leak - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with jack and incomplete tools/with reverse camera/ No warranty booklet/power steering issue/