

General Information

Date & Time: 12, Aug, 2025 10:19

Make	Toyota	Model	Hiace
YOM	2018	Odo Meter Reading	94,925
Registration No.	NCA5280	Chassis No.	JTFJT02P3H0008909
CC	3.0	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



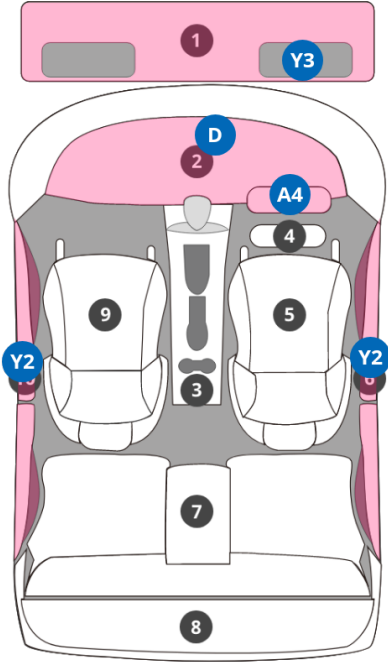
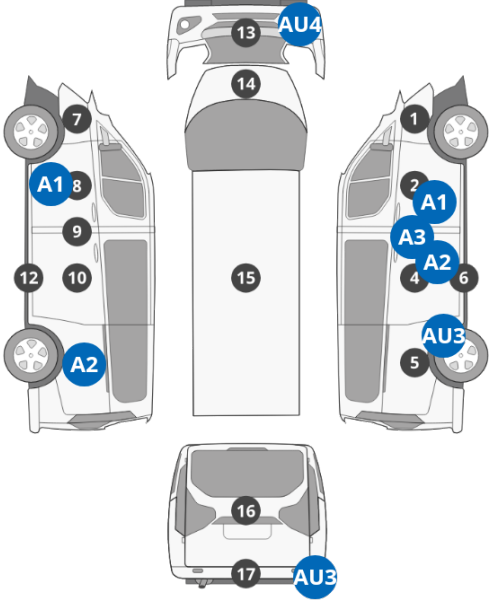
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	454.3	469	454	440
2	Boot Lid	295.6	244	354	289
3	Roof	167.7	164	195	158/154
4	Left Front Fender	442.3	433	442	452
5	Left Front Door	244.0	197	234	301
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	321.3	290	291	383
9	Right Front Fender	456.3	455	454	460
10	Right Front Door	322.3	330	310	327
11	Center Panel Right				
12	Right Rear Door	327.3	306	337	339
13	Right Back Panel	486.3	540	465	454

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Grime - Medium / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Steering Wheel - Worn, Peel, Crack - Large</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Center Panel - Scratch - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : C
<p>Remarks Defects not found</p>	<p>Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>Trunk door and sliding door issue. No reverse light. Folding rear seat issue. Without warranty booklet, jack and tools. With spare tire and leather seat cover. Leather ceiling. 2 keys. With LTO plate.</p>