

General Information

Date & Time: 09, Aug, 2025 15:09

Make	Toyota	Model	Hilux
YOM	2022	Odo Meter Reading	41,320
Registration No.	NFK7032	Chassis No.	MR0JB8DD1N3191297
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Silver		

Body / Panel Condition



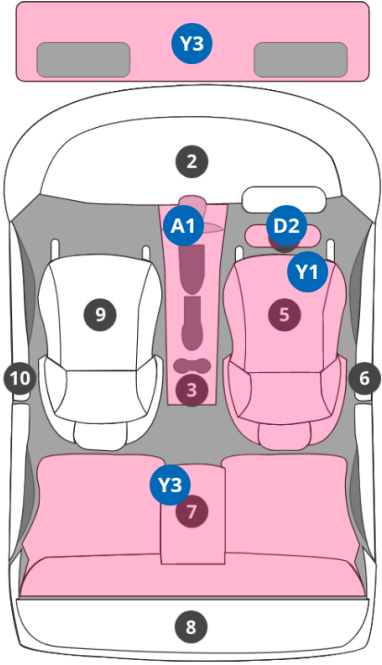
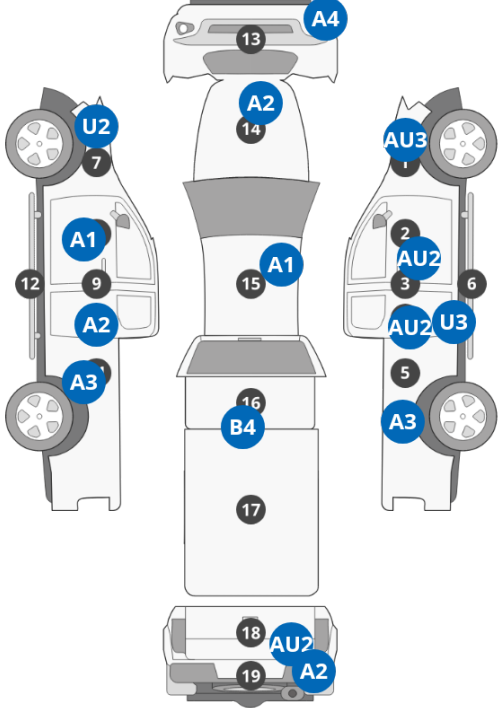
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	123.6	122	128	121
2	Boot Lid	117.6	127	111	115
3	Roof	136.0	116	179	114/135
4	Left Front Fender	120.0	125	118	117
5	Left Front Door	123.3	121	123	126
6	Center Panel Left	118.0	113	113	128
7	Left Rear Door	115.3	115	115	116
8	Left Back Panel	129.6	115	124	150
9	Right Front Fender	133.0	126	125	148
10	Right Front Door	72.5	76	70	71
11	Center Panel Right	113.3	111	114	115
12	Right Rear Door	127.0	134	125	122
13	Right Back Panel	125.3	120	118	138

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / Overall Interior - Worn as per age - Yes / (R) Front Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Minimal / Ceiling - Grime - Medium	Remarks (R) Step, In-panel, Side Spoiler - Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Side Gate - Scratch - Medium / Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Medium / Cargo Bed Floor - Modified - Large / (L) Side Gate - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / Roof - Scratch - Minimal / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, no warranty booklet, with jack and incomplete tools, with spare tire, busted headlight and tail light, scratches on headlight and tail light, original spare tire is installed. Replacement (damaged).