

General Information

Date & Time: 18, Aug, 2025 17:27

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	77,528
Registration No.	NIP2746	Chassis No.	PA1B18F35P4206668
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



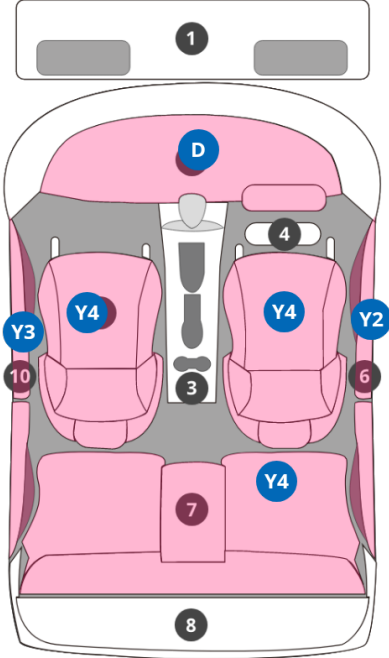
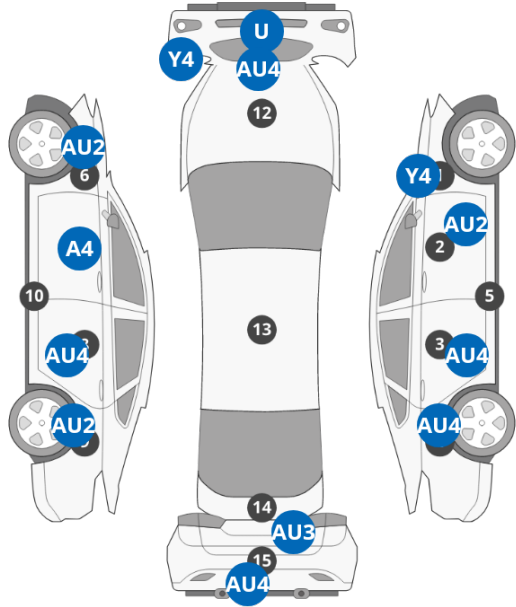
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.5	99	100	103
2	Boot Lid	90.8	92	85	96
3	Roof	97.0	96	88	108/96
4	Left Front Fender	385.6	659	358	140
5	Left Front Door	203.6	300	212	99
6	Center Panel Left				
7	Left Rear Door	92.2	99	94	84
8	Left Back Panel	98.1	100	99	95
9	Right Front Fender	91.2	97	89	88
10	Right Front Door	91.0	90	91	92
11	Center Panel Right				
12	Right Rear Door	93.3	90	94	96
13	Right Back Panel	95.3	95	90	101

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
<div style="text-align: center;">  </div> <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	<div style="text-align: center;">  </div> <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (L) Front Seat - Grime - Large / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Medium</p>	<p>Remarks (R) Step - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Crack, Gap - Large / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Small</p>
Frame Evaluation : C	Functional Evaluation : C
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Power Window (each) - Stuck, Gap - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet/ with spare tire and jack/ with LTO plate/ incomplete tools/ driver side window issue/ with MMDA violation/ driver door issue/ possible flooding</p>