

General Information

Date & Time: 19, Aug, 2025 08:41

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	11,937
Registration No.	DBN8177	Chassis No.	PA1B18F38P4234433
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



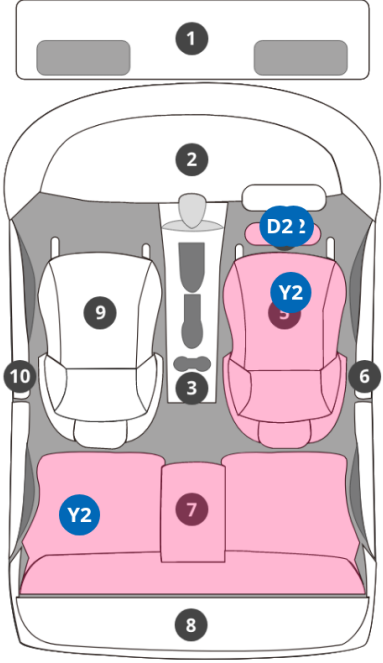
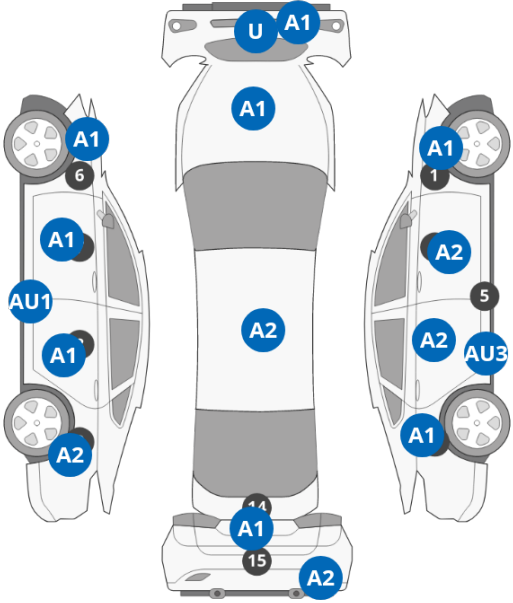
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.3	100	117	102
2	Boot Lid	109.6	108	110	111
3	Roof	105.7	100	101	111/111
4	Left Front Fender	102.3	104	102	101
5	Left Front Door	103.0	99	100	110
6	Center Panel Left				
7	Left Rear Door	112.0	113	111	112
8	Left Back Panel	110.6	110	111	111
9	Right Front Fender	100.3	100	100	101
10	Right Front Door	101.4	111	99	95
11	Center Panel Right				
12	Right Rear Door	114.0	109	106	127
13	Right Back Panel	113.6	117	115	109

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small</p>	<p>Remarks (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>With LTO plate and warranty booklet, Sparetire and Jack, Incomplete Tools. Scratch headlight and tail light.</p>