

General Information

Date & Time: 19, Aug, 2025 13:12

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	122,541
Registration No.	DBO2338	Chassis No.	PA1B18F32P4238140
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



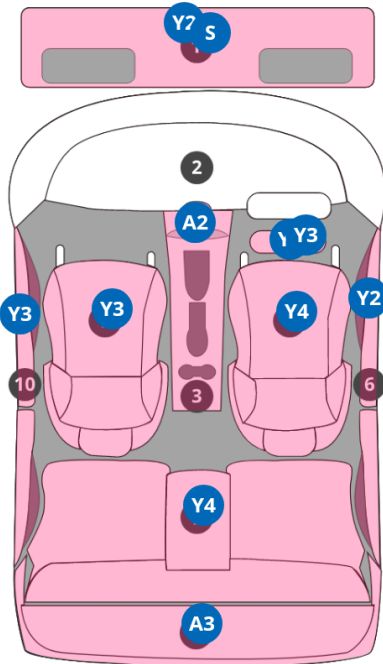
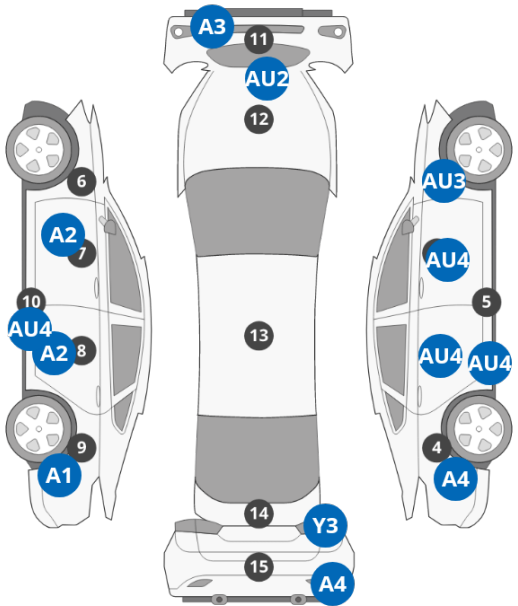
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	107	110	116
2	Boot Lid	107.3	107	101	114
3	Roof	104.7	109	107	101/102
4	Left Front Fender	105.6	105	104	108
5	Left Front Door	106.6	108	104	108
6	Center Panel Left				
7	Left Rear Door	112.6	116	103	119
8	Left Back Panel	125.3	140	123	113
9	Right Front Fender	176.0	151	187	190
10	Right Front Door	111.3	119	104	111
11	Center Panel Right				
12	Right Rear Door	109.0	102	113	112
13	Right Back Panel	117.3	107	115	130

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Medium / Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / (L) Front Trim - Grime - Medium / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Knobs - Worn, Peel, Crack - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch - Large / (R) Front Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Crack, Gap - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with warranty booklet/with reverse camera/No jack and tools/No spare key/possible flooding/right side tail light cover crack/rear left side door issue</p>