

General Information

Date & Time: 15, Aug, 2025 10:41

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	21,576
Registration No.	BAF9221	Chassis No.	PA1B18F36R4243652
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



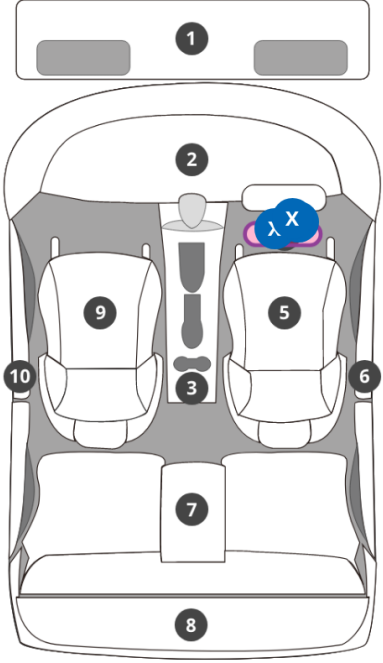
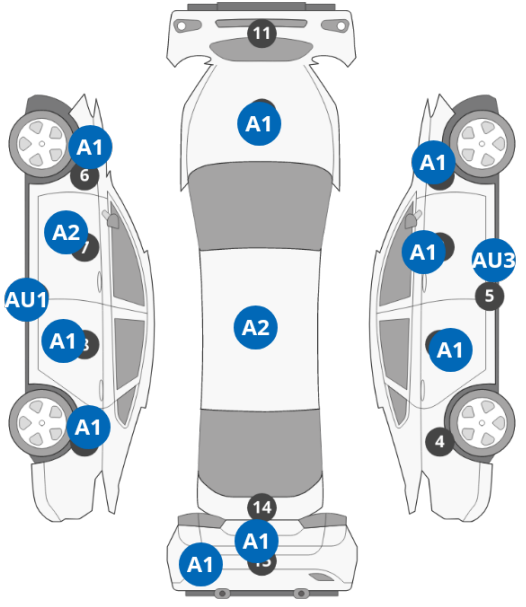
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.3	109	108	105
2	Boot Lid	102.0	100	100	106
3	Roof	96.7	96	94	98/99
4	Left Front Fender	94.6	97	94	93
5	Left Front Door	98.6	96	106	94
6	Center Panel Left				
7	Left Rear Door	98.5	99	97	99
8	Left Back Panel	103.3	104	103	103
9	Right Front Fender	95.0	100	92	93
10	Right Front Door	99.5	99	100	99
11	Center Panel Right				
12	Right Rear Door	105.0	106	106	103
13	Right Back Panel	99.8	100	97	103

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>With LTO plate and warranty booklet, Sparetire and Jack, Incomplete Tools. scratch headlight and tail light.</p>