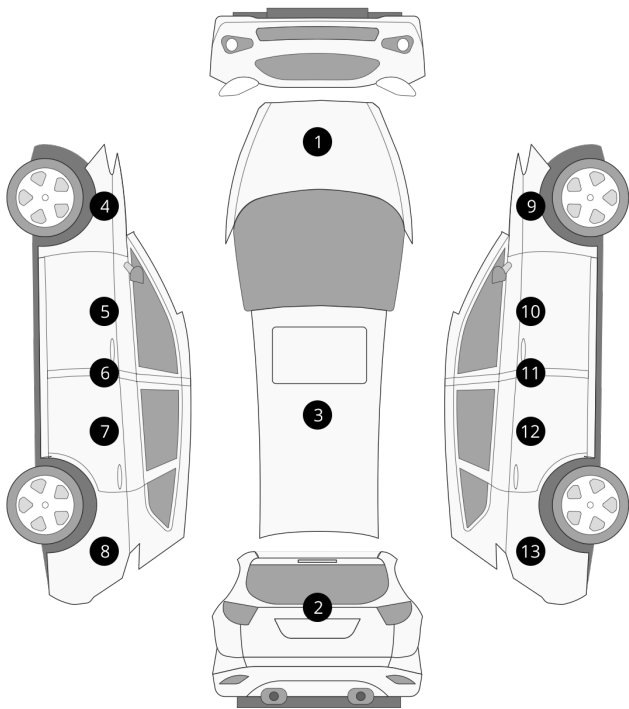


General Information

Date & Time: 19, Aug, 2025 15:36

Make	Toyota	Model	Innova
YOM	2024	Odo Meter Reading	20,751
Registration No.	NHH6932	Chassis No.	PA2JA8EM0R0136556
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



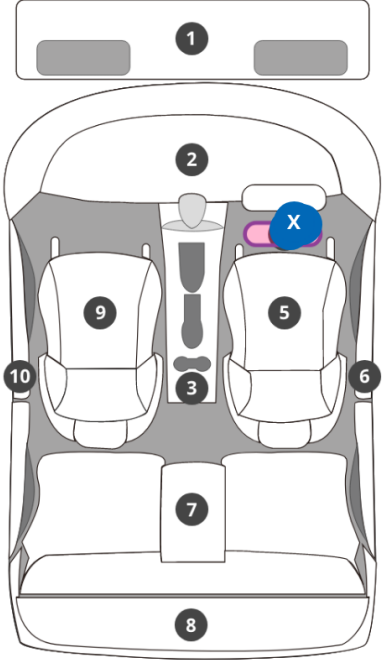
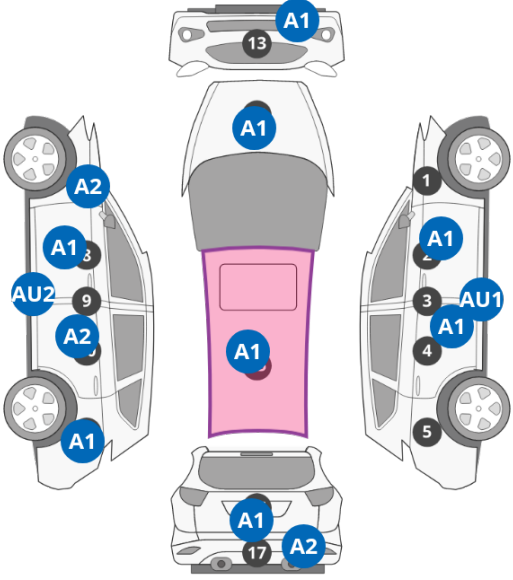
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.3	114	121	126
2	Boot Lid	98.1	106	99	90
3	Roof	105.7	100	102	110/111
4	Left Front Fender	112.6	100	119	119
5	Left Front Door	112.6	112	116	110
6	Center Panel Left				
7	Left Rear Door	106.3	106	104	109
8	Left Back Panel	114.0	119	109	114
9	Right Front Fender	110.6	106	110	116
10	Right Front Door	108.3	108	108	109
11	Center Panel Right				
12	Right Rear Door	101.2	99	102	103
13	Right Back Panel	106.3	106	108	105

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes</p>	<p>Remarks (L) Front Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Roof - Scratch - Minimal / Roof Spoiler, Molding - Partially Missing - Yes</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>With LTO plate and warranty booklet and Sparetire, Incomplete Tools. No Jack, scratch headlight and tail light.</p>