

General Information

Date & Time: 19, Aug, 2025 08:23

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	72,515
Registration No.	NIO2893	Chassis No.	PA1B18F35P4218190
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



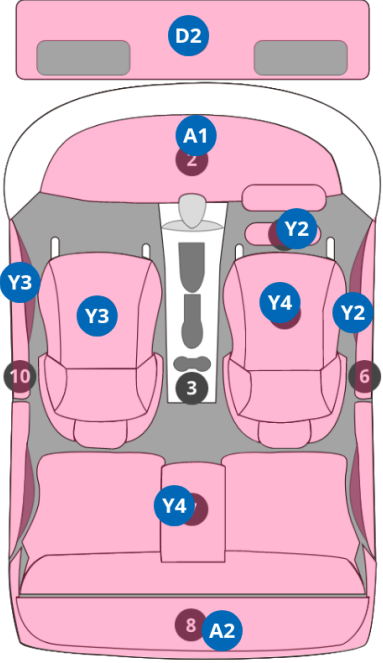
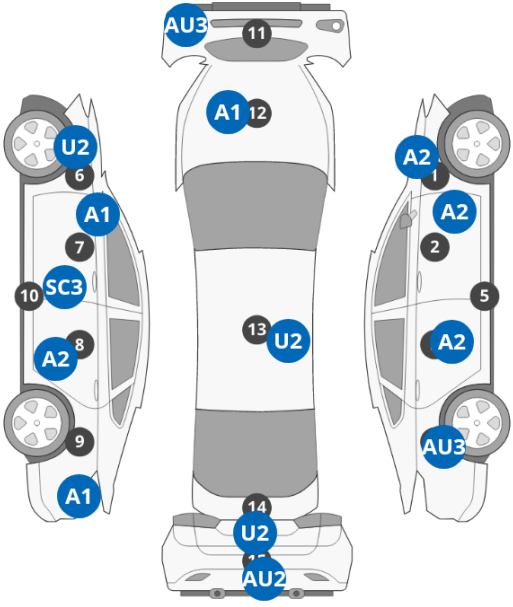
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.0	127	124	115
2	Boot Lid	113.3	106	116	118
3	Roof	112.0	118	110	101/119
4	Left Front Fender	101.8	105	98	103
5	Left Front Door	96.8	97	96	97
6	Center Panel Left				
7	Left Rear Door	104.3	111	103	99
8	Left Back Panel	115.6	114	108	125
9	Right Front Fender	107.0	109	105	107
10	Right Front Door	105.8	109	98	110
11	Center Panel Right				
12	Right Rear Door	112.2	99	99	139
13	Right Back Panel	115.0	109	112	124

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Medium / Ceiling - Crinkle - Small / Dashboard - Worn, Scratch, Cut, Crack - Minimal</p>	<p>Remarks (L) Front Fender, Molding - Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Rust, Corrosion - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Roof - Dent - Small / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Door Lock - Issue - Yes / Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with jack and incomplete tools/ park lights issue/No spare key/with reverse camera/with warranty booklet Door lock issue</p>