

General Information

Date & Time: 18, Aug, 2025 17:58

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	28,102
Registration No.	NKC6663	Chassis No.	PA1B18F37R4256023
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



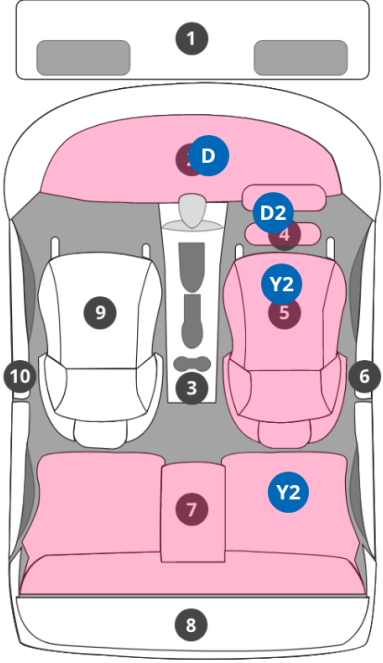
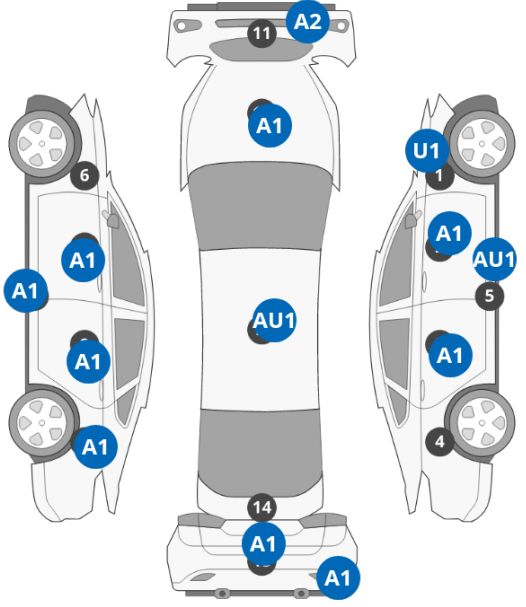
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	119	110	113
2	Boot Lid	111.0	106	105	122
3	Roof	104.4	110	97	105/106
4	Left Front Fender	99.9	100	100	100
5	Left Front Door	103.6	100	100	111
6	Center Panel Left				
7	Left Rear Door	103.1	111	100	99
8	Left Back Panel	108.3	105	112	108
9	Right Front Fender	97.6	97	97	98
10	Right Front Door	95.4	107	105	74
11	Center Panel Right				
12	Right Rear Door	107.0	104	103	114
13	Right Back Panel	98.9	102	91	104

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Roof - Scratch & Dent - Minimal / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Defects not found</p>

<p>Inspector Notes</p>
<p>With LTO plate and warranty booklet, Spare tire. No Tools and Jack, Scratch headlight and tail light.</p>