

General Information

Date & Time: 18, Aug, 2025 14:54

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	59,742
Registration No.	DBF3016	Chassis No.	PA1B18F33M4158311
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



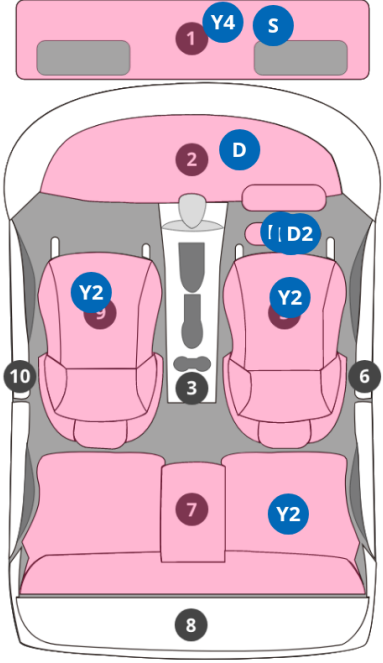
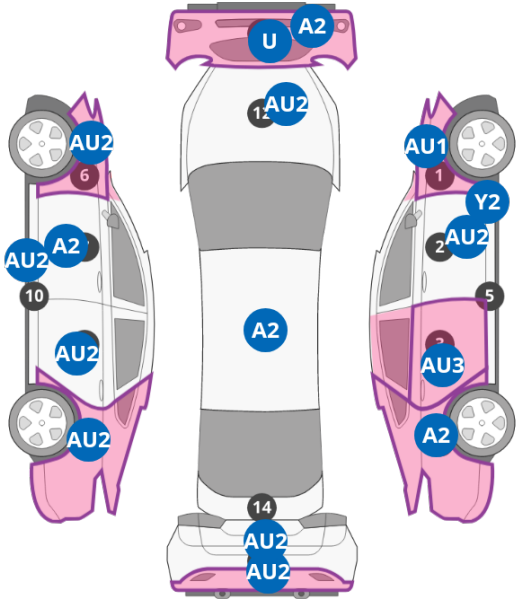
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.0	124	116	138
2	Boot Lid	114.3	111	106	126
3	Roof	114.0	148	103	103/102
4	Left Front Fender	98.7	92	96	109
5	Left Front Door	108.3	107	115	103
6	Center Panel Left				
7	Left Rear Door	103.6	107	101	103
8	Left Back Panel	123.3	122	124	124
9	Right Front Fender	100.1	98	100	102
10	Right Front Door	108.2	99	105	121
11	Center Panel Right				
12	Right Rear Door	101.1	100	100	104
13	Right Back Panel	133.0	116	131	152

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Overall Interior - Smell - Yes / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Large / (L) Front Floor Mat - Worked - Large / (R) Front Floor Mat - Worked - Small / Mat Other - Worked - Small</p>	<p>Remarks (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Small / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Crack, Gap - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : D
<p>Remarks Defects not found</p>	<p>Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Shift Shock - Function - Weak / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire and, Incomplete Tools. No Jack and Warranty booklet, possible flooded, Scratch headlight and tail light crack. Warning lamps on airbag, Tow hook cover missing, worn tires and Sparetire, rear bumper reflector missing, adhesive marks on wind shield and vehicle body,</p>