

General Information

Date & Time: 18, Aug, 2025 09:59

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	55,940
Registration No.	NFB1284	Chassis No.	PA1B18F36P4294347
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



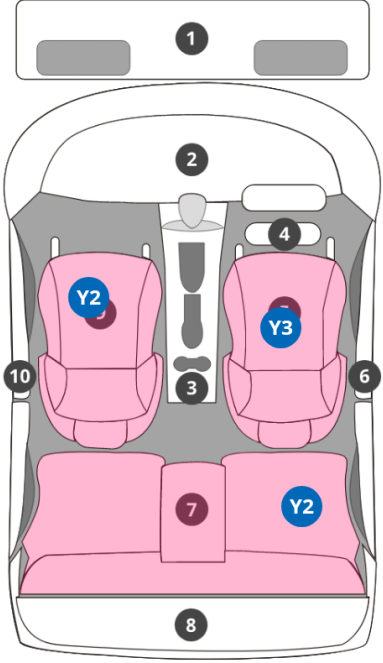
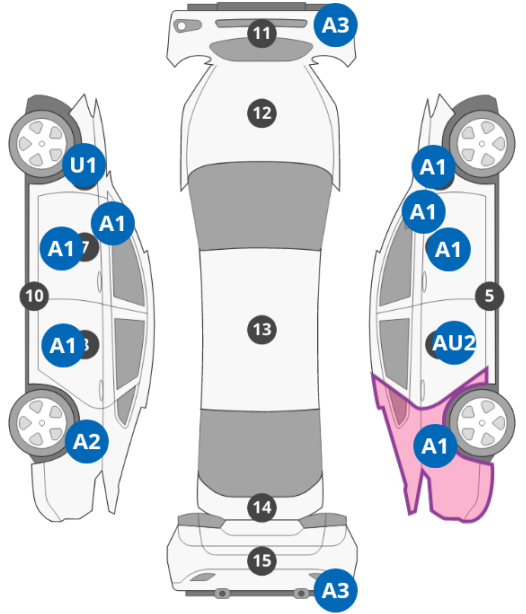
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	116	109	104
2	Boot Lid	108.6	105	104	117
3	Roof	94.2	96	94	87/100
4	Left Front Fender	95.4	91	96	100
5	Left Front Door	102.6	102	105	101
6	Center Panel Left				
7	Left Rear Door	103.3	102	108	100
8	Left Back Panel	104.6	112	102	100
9	Right Front Fender	101.1	102	99	102
10	Right Front Door	105.3	100	107	109
11	Center Panel Right				
12	Right Rear Door	103.8	98	107	107
13	Right Back Panel	342.6	683	196	149

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Small</p>	<p>Remarks (R) Rear Fender - Repair Traces - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with warranty booklet/with jack and tools/with spare key /No reverse camera</p>