

General Information

Date & Time: 18, Aug, 2025 15:56

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	47,917
Registration No.	NFF2485	Chassis No.	PA1B18F35P4233787
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



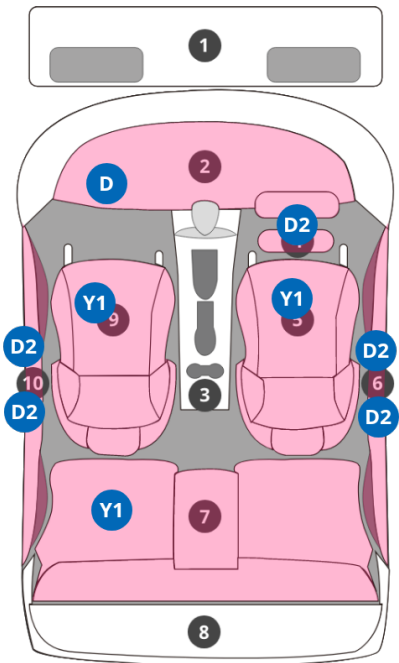
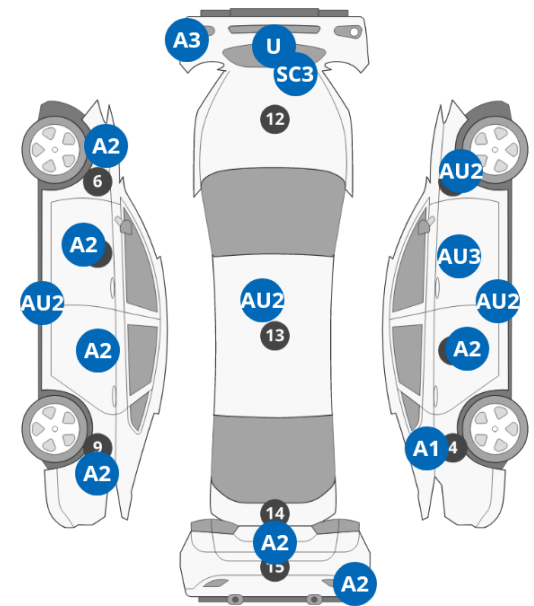
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.9	117	94	113
2	Boot Lid	119.6	115	127	117
3	Roof	100.8	98	105	94/106
4	Left Front Fender	100.7	105	97	100
5	Left Front Door	99.6	100	100	99
6	Center Panel Left				
7	Left Rear Door	106.3	112	106	101
8	Left Back Panel	119.6	123	117	119
9	Right Front Fender	105.6	109	103	105
10	Right Front Door	111.6	111	113	111
11	Center Panel Right				
12	Right Rear Door	106.6	106	104	110
13	Right Back Panel	122.6	115	112	141

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Rear Trim - Worked - Small / (R) Rear Trim - Worked - Small / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / (L) Front Seat - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Member (Bolted) - Dent - Yes / Roof - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Bonnet, Headlight - Rust, Corrosion - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate but Incomplete rear plate is temporary plate,with Sparetire and Jack. No warranty booklet and Tools. Busted Plate light. Scratch headlight and tail light.</p>