

General Information

Date & Time: 18, Aug, 2025 15:28

Make	Toyota	Model	Innova
YOM	2023	Odo Meter Reading	78,976
Registration No.	NHI6551	Chassis No.	PA2JA8EM1P0122517
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



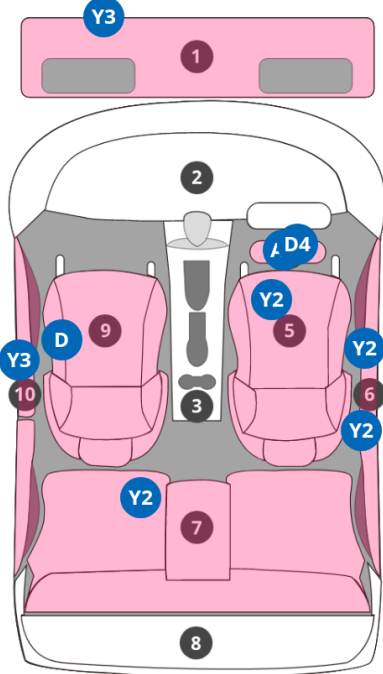
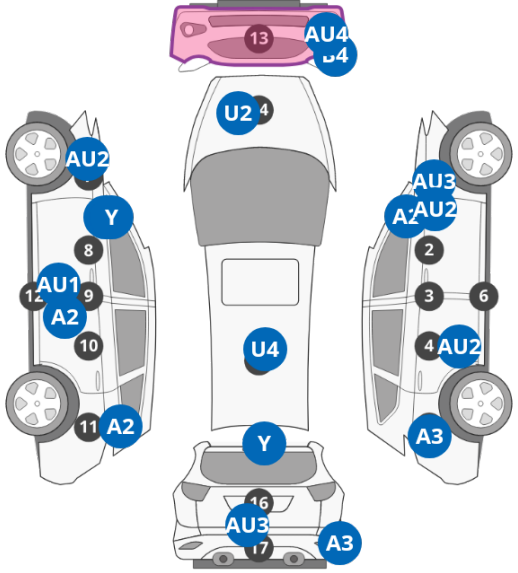
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.4	96	157	100
2	Boot Lid	107.8	99	123	102
3	Roof	95.8	106	98	88/92
4	Left Front Fender	203.6	195	173	243
5	Left Front Door	119.0	117	120	120
6	Center Panel Left				
7	Left Rear Door	107.3	116	103	103
8	Left Back Panel	108.6	104	106	116
9	Right Front Fender	107.0	116	106	99
10	Right Front Door	101.7	97	100	108
11	Center Panel Right				
12	Right Rear Door	103.3	101	103	106
13	Right Back Panel	103.8	103	100	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Floor Mat - Worked - Large / (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / (R) Rear Trim - Grime - Small / Rear Seat - Grime - Small / (L) Front Trim - Grime - Medium / Ceiling - Grime - Medium / (R) Front Trim - Grime - Small</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Modified - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Dent - Small / Roof - Dent - Large / Antennae - Damaged - Yes / (L) Mirror - Crack - Damaged</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>	
<p>no warranty booklet, no jack, with tools, with spare tire, with LTO plate, scratches on headlight and tail light, cracked tail light, right fog lamp missing, left headlight deformed issue</p>	