

General Information

Date & Time: 25, Nov, 2024 13:16

Make	Toyota	Model	Avanza
YOM	2023	Mileage	13,721
Registration No.	NIN7201	Chassis No.	MHFAA1BY6P0013523
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



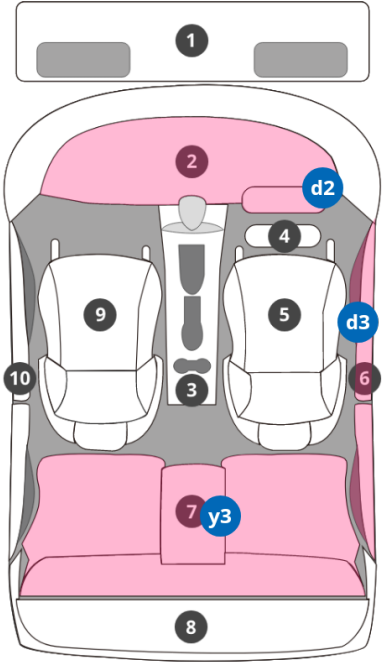
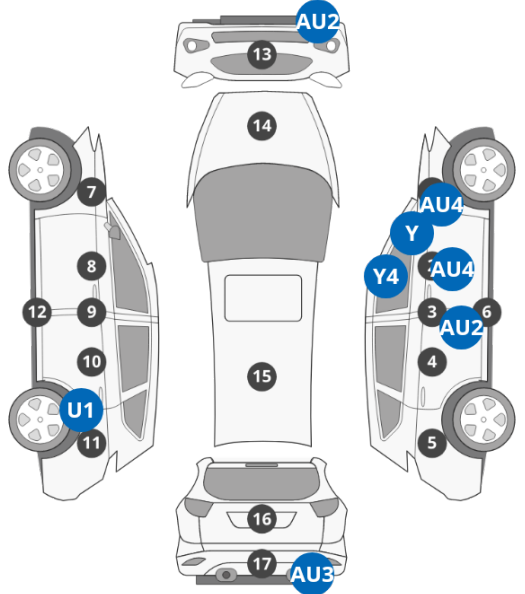
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.0	114	115	125
2	Boot Lid	113.2	124	121	95
3	Roof	131.0	129	113	151/131
4	Left Front Fender	102.6	103	103	102
5	Left Front Door	116.0	112	113	123
6	Center Panel Left				
7	Left Rear Door	137.6	141	131	141
8	Left Back Panel	110.3	117	108	106
9	Right Front Fender	154.0	148	149	165
10	Right Front Door	140.0	131	142	147
11	Center Panel Right				
12	Right Rear Door	210.0	172	235	223
13	Right Back Panel	107.0	112	100	109

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Loose, Deformed - Medium / Rear Seat - Grime - Medium / Dashboard - Loose, Deformed - Small	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Door, Molding - Scratch & Dent - Large / (R) Side Window - Damaged - Large / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (L) Rear Fender, Molding - Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Small / (R) Mirror - Crack - Damaged
Frame Evaluation : D	Functional Evaluation : C
Remarks Right Front Pillar - Condition of Welding ? - Yes	Remarks Power Window (each) - Stuck, Gap - Yes / Door Lock - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

no warranty booklet/ no tools and jack/ with spare tire/ front passenger door cannot be opened and closed/ door/ no right side mirror/