

General Information

Date & Time: 18, Aug, 2025 13:39

Make	Toyota	Model	Raize
YOM	2023	Odo Meter Reading	33,139
Registration No.	NIO3390	Chassis No.	MHKAB1BA5PJ045147
CC	1.2	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Silver		

Body / Panel Condition



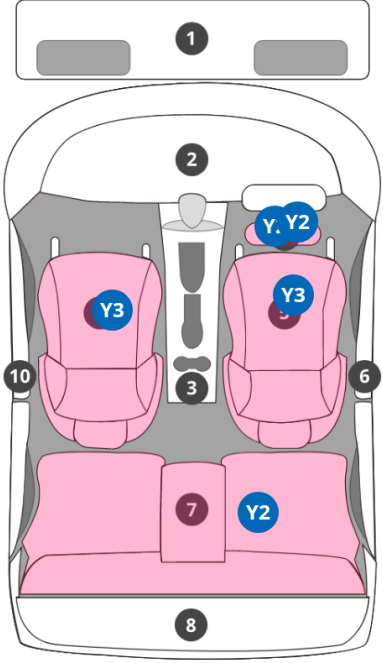
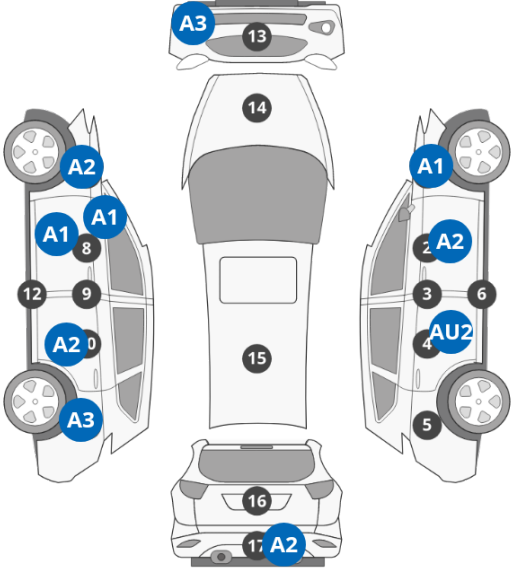
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.0	106	122	111
2	Boot Lid	96.5	90	105	95
3	Roof	96.8	114	103	84/87
4	Left Front Fender	100.4	95	113	94
5	Left Front Door	101.6	96	108	101
6	Center Panel Left				
7	Left Rear Door	102.2	105	98	104
8	Left Back Panel	85.6	77	80	100
9	Right Front Fender	104.6	105	109	100
10	Right Front Door	106.6	103	112	105
11	Center Panel Right				
12	Right Rear Door	99.9	101	100	99
13	Right Back Panel	88.4	86	91	88

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Small</p>	<p>Remarks (R) Rear Door, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/No jack and tools/No spare key/with reverse camera/No warranty booklet</p>