

General Information

Date & Time: 18, Aug, 2025 16:50

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	28,951
Registration No.	NIU4124	Chassis No.	PA1B18F36P4237492
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



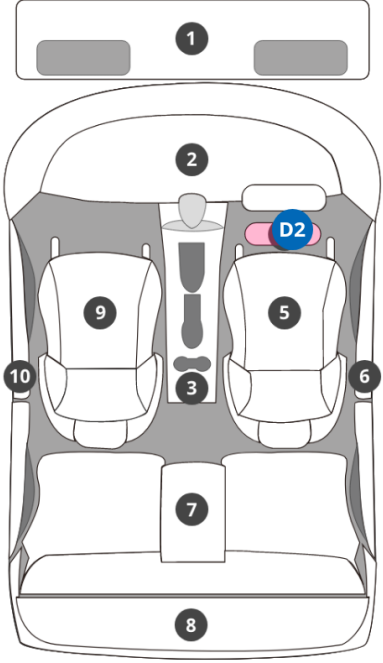
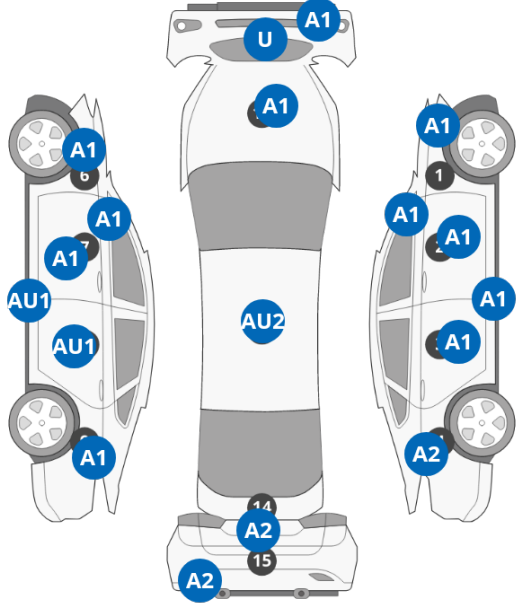
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	120.6	120	115	127
2	Boot Lid	117.6	116	121	116
3	Roof	121.5	142	108	113/123
4	Left Front Fender	111.0	110	108	115
5	Left Front Door	139.6	141	138	140
6	Center Panel Left				
7	Left Rear Door	121.3	144	106	114
8	Left Back Panel	118.6	118	124	114
9	Right Front Fender	108.3	107	107	111
10	Right Front Door	115.3	116	118	112
11	Center Panel Right				
12	Right Rear Door	118.3	113	115	127
13	Right Back Panel	118.6	120	117	119

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Worked - Small	Remarks (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
With LTO plate and warranty booklet and Sparetire, Jack. No Tools and Scratch headlight and tail light.