

General Information

Date & Time: 19, Aug, 2025 15:04

Make	Toyota	Model	Innova
YOM	2022	Odo Meter Reading	53,014
Registration No.	NEL7771	Chassis No.	PA2JA8EM5N0110867
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red Mica Metallic		

Body / Panel Condition



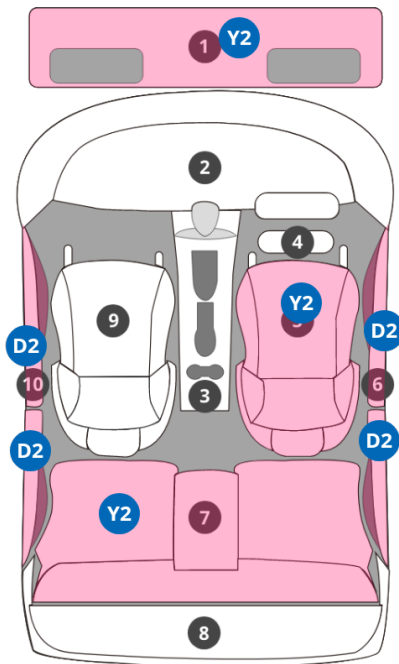
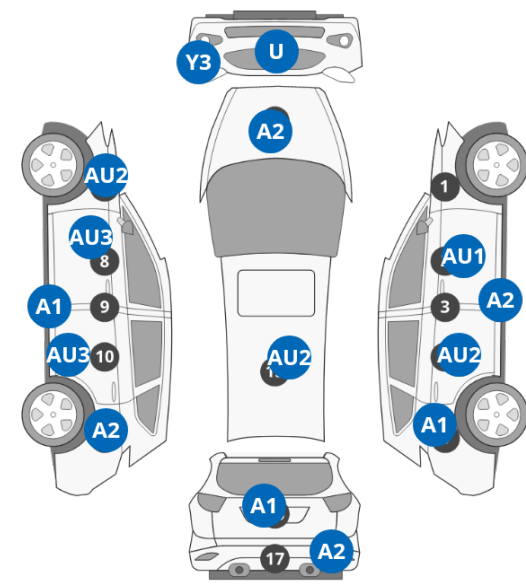
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.4	90	126	109
2	Boot Lid	106.3	104	106	109
3	Roof	103.9	111	90	113/102
4	Left Front Fender	111.3	113	112	109
5	Left Front Door	122.6	129	123	116
6	Center Panel Left				
7	Left Rear Door	118.6	126	124	106
8	Left Back Panel	120.3	128	118	115
9	Right Front Fender	105.8	97	105	116
10	Right Front Door	109.3	104	111	113
11	Center Panel Right				
12	Right Rear Door	108.6	109	107	110
13	Right Back Panel	113.6	111	109	121

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Worked - Small / (L) Rear Trim - Worked - Small / (R) Front Trim - Worked - Small / (R) Rear Trim - Worked - Small / Ceiling - Grime - Small</p>	<p>Remarks (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Member (Bolted) - Dent - Yes / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Head Light, High Beam - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and warranty booklet and Sparetire, Jack. No Tools No headlight bulb and foglight bulb. rear head rest missing. Scratch headlight and tail light.</p>