

General Information

Date & Time: 15, Aug, 2025 19:08

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	36,165
Registration No.	CCD1599	Chassis No.	PA1B18F39R4246626
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



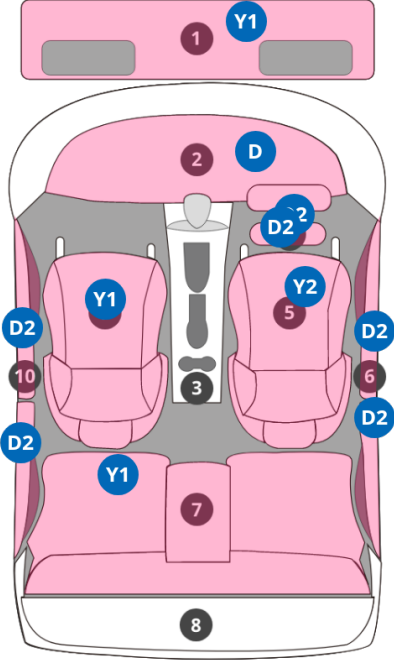
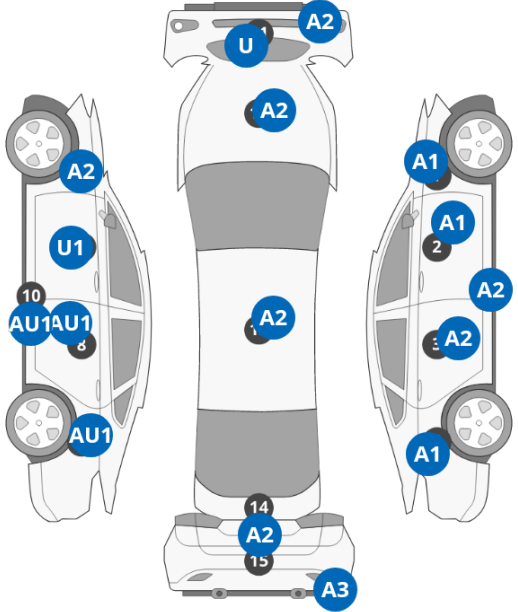
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	112	102	115
2	Boot Lid	102.7	99	106	103
3	Roof	112.7	118	102	119/112
4	Left Front Fender	95.2	97	94	94
5	Left Front Door	100.6	102	100	100
6	Center Panel Left				
7	Left Rear Door	100.7	104	103	95
8	Left Back Panel	109.6	110	114	105
9	Right Front Fender	100.5	99	102	101
10	Right Front Door	104.0	104	103	105
11	Center Panel Right				
12	Right Rear Door	103.8	97	99	115
13	Right Back Panel	110.3	113	103	115

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes / Rear Seat - Grime - Minimal / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Minimal / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Rear Trim - Worked - Small / (R) Rear Trim - Worked - Small	Remarks (L) Front Door, Molding - Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
With LTO plate and Sparetire, Incomplete Tools. No warranty booklet and Jack, Scratch headlight and tail light, Crack right tail light. worn tires and Sparetire.