

General Information

Date & Time: 16, Aug, 2025 14:51

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	23,246
Registration No.	NHS1485	Chassis No.	MHKAA1BCPJ008393
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



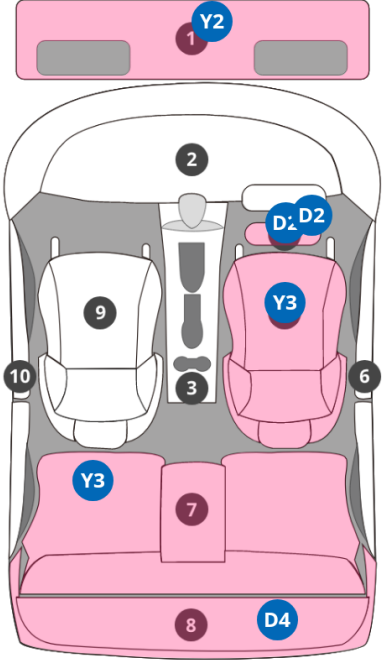
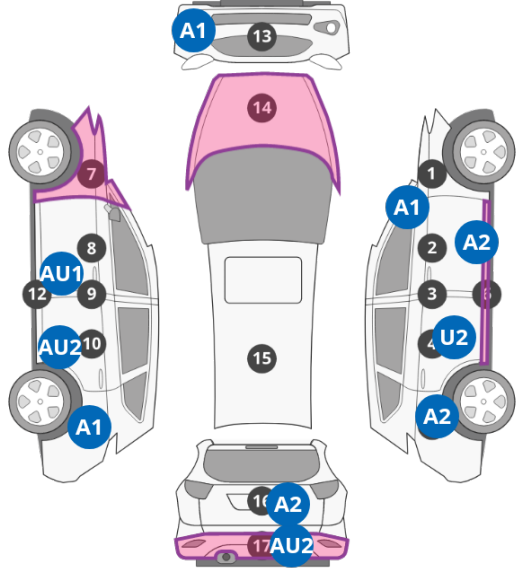
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.3	114	139	123
2	Boot Lid	115.6	114	121	112
3	Roof	91.4	84	88	94/100
4	Left Front Fender	253.3	495	126	139
5	Left Front Door	107.3	101	111	110
6	Center Panel Left				
7	Left Rear Door	97.1	108	98	85
8	Left Back Panel	90.7	86	87	100
9	Right Front Fender	93.5	90	97	93
10	Right Front Door	111.0	117	112	104
11	Center Panel Right				
12	Right Rear Door	100.5	97	98	107
13	Right Back Panel	100.3	111	94	96

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	C	Exterior Evaluation :	C
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / (R) Front Floor Mat - Worked - Small / (R) Front Seat - Grime - Medium / Trunk Room - Loose, Deformed - Large / Rear Seat - Grime - Medium</p>		<p>Remarks Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Dent - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Defects not found</p>	

Inspector Notes
<p>with warranty booklet, 2keys,with lto plate, with jack and spare tire, no tools, headlight scratches, hood repair marks, right step in dent and repair, front fender left trace of repaint,rear bumper traces of repair mark.</p>