

General Information

Date & Time: 19, Aug, 2025 15:04

Make	Toyota	Model	Rush
YOM	2021	Odo Meter Reading	45,687
Registration No.	NGR3566	Chassis No.	MHKE8FF3PLK027640
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



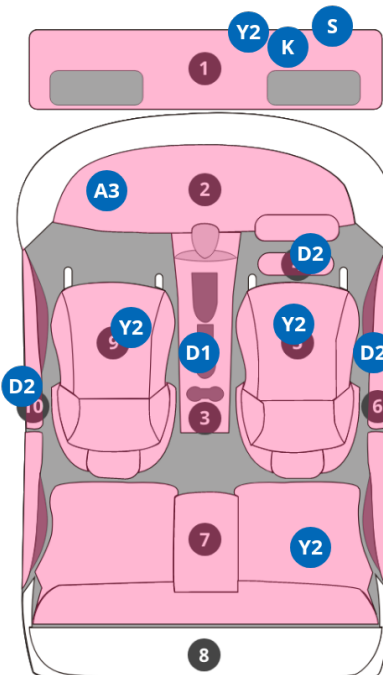
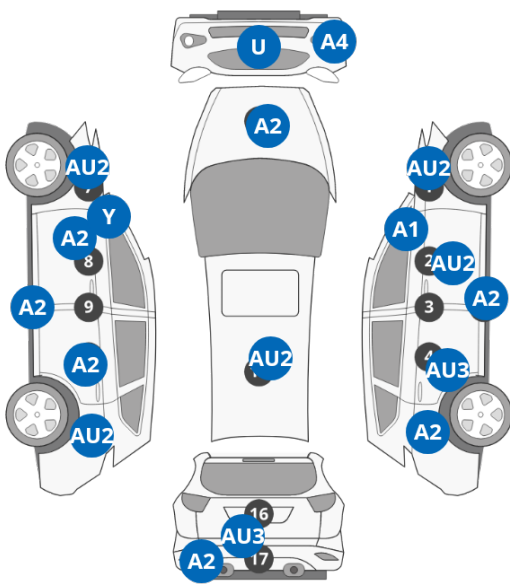
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	111	129	101
2	Boot Lid	106.8	109	112	100
3	Roof	86.3	68	84	104/89
4	Left Front Fender	110.6	118	113	101
5	Left Front Door	109.0	116	104	107
6	Center Panel Left				
7	Left Rear Door	99.1	99	107	92
8	Left Back Panel	95.5	96	100	90
9	Right Front Fender	106.3	100	108	111
10	Right Front Door	100.6	100	102	100
11	Center Panel Right				
12	Right Rear Door	99.8	100	103	96
13	Right Back Panel	95.9	100	94	94

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Worked - Small / Steering Wheel - Worn, Peel, Crack - Medium / (R) Front Seat - Grime - Small / (R) Front Trim - Worked - Small / (L) Front Trim - Worked - Small / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Overall Interior - Animal Hair - Yes / Rear Seat - Grime - Small / (L) Front Seat - Grime - Small / Console, Switchs, Vents - Worked - Minimal</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Small / Member (Bolted) - Dent - Yes / (L) Mirror - Crack - Damaged</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire. No warranty booklet and Tools, Jack. scratch and Crack Tail light and headlight. worn Sparetire and Tire.</p>