

General Information

Date & Time: 22, Aug, 2025 08:40

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	44,406
Registration No.	DAQ6983	Chassis No.	PA1B18F34N4178844
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



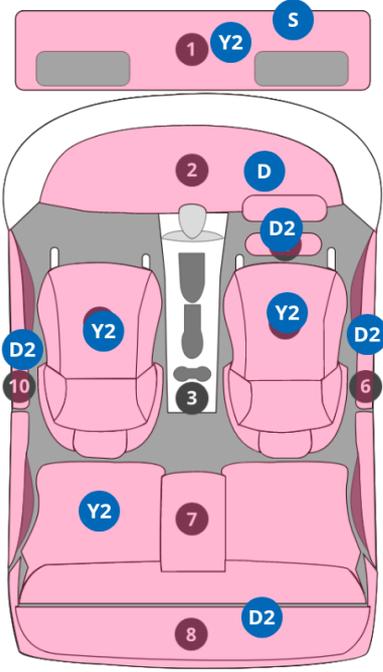
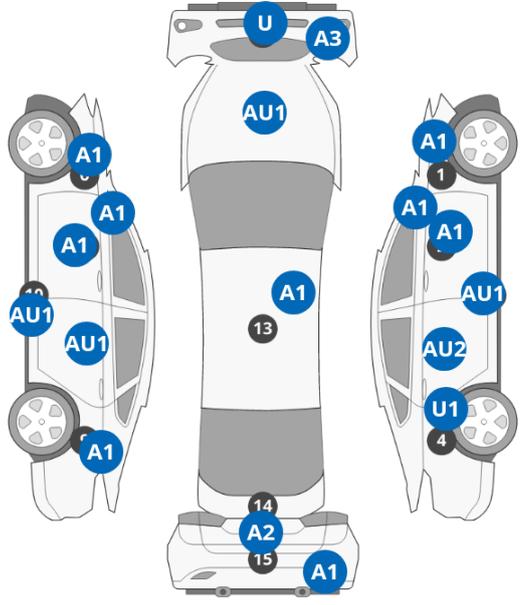
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.9	112	95	111
2	Boot Lid	111.3	111	109	114
3	Roof	112.9	137	87	142/86
4	Left Front Fender	96.4	99	95	96
5	Left Front Door	119.8	97	99	164
6	Center Panel Left				
7	Left Rear Door	137.3	141	132	139
8	Left Back Panel	130.6	152	129	111
9	Right Front Fender	89.5	94	87	88
10	Right Front Door	128.6	139	129	118
11	Center Panel Right				
12	Right Rear Door	108.6	117	104	105
13	Right Back Panel	119.0	123	118	116

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / (L) Front Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Overall Interior - Smell - Yes / Trunk Room - Loose, Deformed - Small</p>	<p>Remarks (L) Rear Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / (R) Rear Fender, Molding - Dent - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch & Dent - Minimal / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Mirror - Scratch - Minimal / (L) Mirror - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>With LTO plate and Sparetire and Incomplete Tools. No Jack and Warranty booklet, scratch headlight and tail light. adhesive marks on vehicle. worn Sparetire and tires.</p>