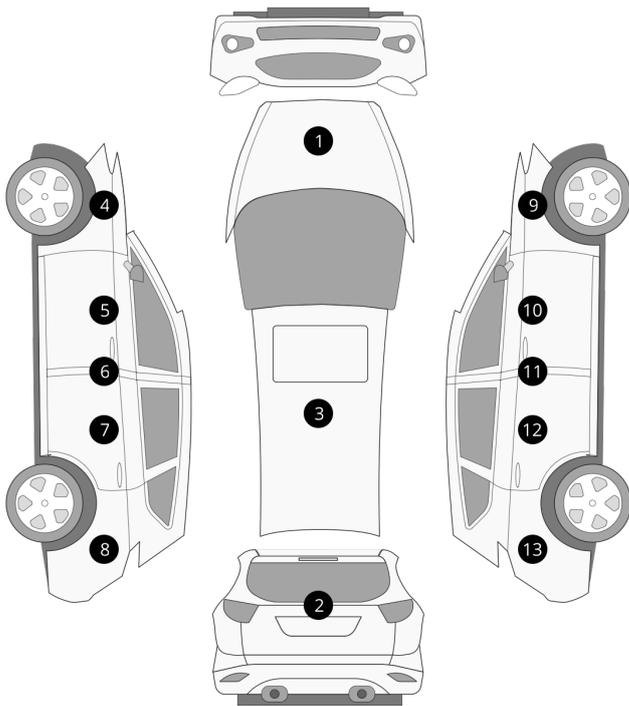


General Information

Date & Time: 19, Aug, 2025 15:36

Make	Toyota	Model	Fortuner
YOM	2024	Odo Meter Reading	13,572
Registration No.	NFR2316	Chassis No.	MHFCB3GS9P0494874
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Gray		

Body / Panel Condition



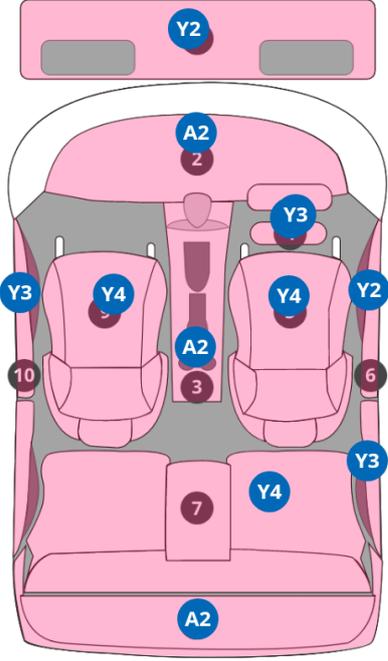
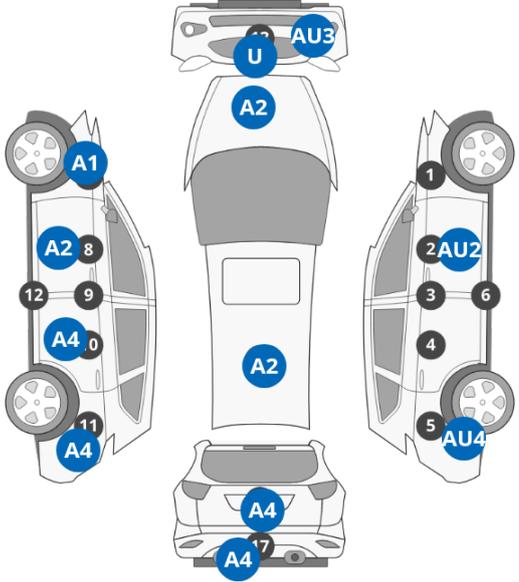
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	126.6	125	126	129
2	Boot Lid	112.0	103	123	110
3	Roof	118.2	124	129	111/109
4	Left Front Fender	123.6	121	123	127
5	Left Front Door	119.0	124	117	116
6	Center Panel Left				
7	Left Rear Door	112.3	123	111	103
8	Left Back Panel	122.0	127	119	120
9	Right Front Fender	121.3	133	115	116
10	Right Front Door	123.6	121	123	127
11	Center Panel Right				
12	Right Rear Door	113.6	113	107	121
13	Right Back Panel	126.6	127	117	136

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Medium / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium / Mat Other - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Large / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small	Remarks Trunk Hood, Rear Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / Roof - Scratch - Small / Member (Bolted) - Dent - Yes
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
No LTO plate/with spare tire/with jack and tools/No spare key/seats with moulds/foul smell/with reverse camera